

MARSHALL PIPE & SUPPLY COMPANY

SPEIGHT #1:

1400' from South line and
1280' from East line,
S/2 Section 22, T2S, R29E
Roosevelt County, New Mexico
containing 320 acres, more or less


5-1/2" Casing
Top of Cement @ 6000'
15 Centralizers run on
first 15 Joints, total
598' Top of
Centralizers at 6601'
Ran 20-5-1/2" wall Scratchers

Ran 177 Jts., 5-1/2" OD
Seamless Casing, 17#,
J55 and K55, set at 7199'
cemented with 250 sacks
Premium with 4# salt, 2#
DFR3 with 500 gal. mud
flush, displaced with
KCL water.

Halliburton Services bumped plug
at 1500# and tested 5-1/2" Casing
at 2000# psi. 5-1/2" Casing
had been tested to 5000# psi
cold water test before run in hole,
also drifted.

Float Collar: 7186.70'
with Halliburton Latch
down plug and latch down
baffle.

Float Guide Shoe: 7199'

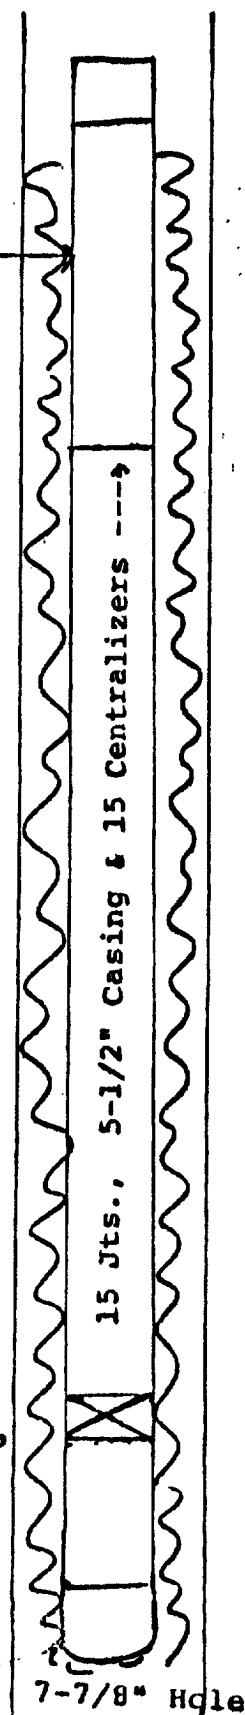

TD: 7200'

RECEIVED

FEB 8 1988

OCD
HOBBS OFFICE