

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103
(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

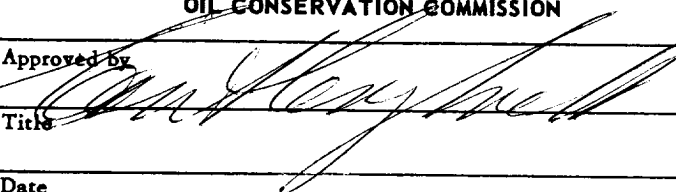
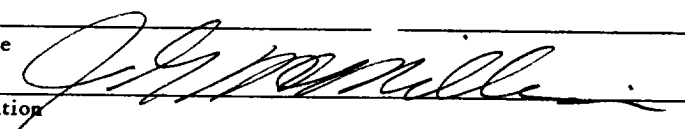
Name of Company Murphy H. Baxter		Address 507 Midland Nat'l Bank Bldg. Midland, Texas				
Lease State "18-13"	Well No. 5	Unit Letter 0	Section 13	Township 17-S	Range 32-E	
Date Work Performed 4-30-59	Pool Maljamar		County Lea			

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations ☒ Casing Test and Cement Job ☐ Other (Explain):
☐ Plugging ☐ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

Spudded in @ 5:00 P.M. 4-30-59. Drilled 12 1/4" hole to 204'. Ran and cemented 6 joints (191.50') of 8 5/8" 24# J-55 SRT ST&C seamless Spang casing @ 202.5' with 150 sacks of 4% Gel cement. Cement circulated. WOC 24 hours. Released pressure and nipped up blow out preventers. Tested casing with 1000# for 30 minutes. Casing tested OK.

Witnessed by W. U. Sumner		Position Engineer		Company Murphy H. Baxter		
FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY						
ORIGINAL WELL DATA						
D F Elev.	T D	P B T D		Producing Interval		Completion Date
Tubing Diameter		Tubing Depth		Oil String Diameter		Oil String Depth
Perforated Interval(s)						
Open Hole Interval				Producing Formation(s)		
RESULTS OF WORKOVER						
Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover						
After Workover						
OIL CONSERVATION COMMISSION				I hereby certify that the information given above is true and complete to the best of my knowledge.		
Approved by 				Name 		
Title				Position Petroleum Engineer		
Date				Company Murphy H. Baxter		