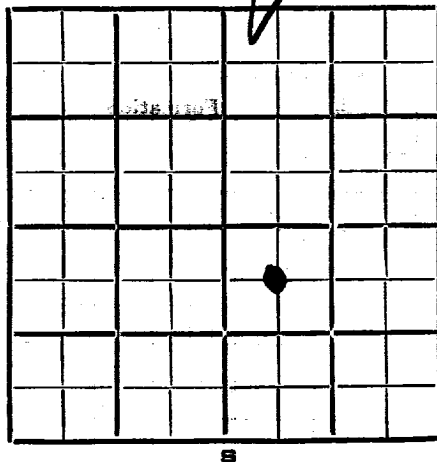


# SCOUT REPORT

## NEW MEXICO

### OIL CONSERVATION COMMISSION

Company Fair and PopeFarm Name JohnsWell No. 1-BLand Classification GovernmentSec. 26 Twp. 17 Range 32 County San JuanFeet from Line: N. 1980 S. 1980 E. W.Elevation \_\_\_\_\_ Method SpudsterContractor Dodson ScoutSpudded 8-17-40 Completed 12-16-40 Initial Production

Bond Status \_\_\_\_\_

#### Amount

#### Casing and Cementing Record

| Size          | Feet        | Inches | Sex Cement     |
|---------------|-------------|--------|----------------|
| <u>12 1/4</u> | <u>60</u>   |        | <u>3</u>       |
| <u>8 1/4</u>  | <u>108</u>  |        | <u>75 + 36</u> |
| <u>7"</u>     | <u>3734</u> |        | <u>100</u>     |

#### Tubing Record

|             |             |
|-------------|-------------|
| <u>2"</u>   | <u>4275</u> |
| <u>perf</u> | <u>4275</u> |

#### ACID RECORD

Gals. \_\_\_\_\_

Top Pay \_\_\_\_\_

TD \_\_\_\_\_

TA 1057TS 1192BS 2250

TRS \_\_\_\_\_

TBL \_\_\_\_\_

TWL \_\_\_\_\_

#### SHOOTING RECORD

|                          |                       |                     |                  |
|--------------------------|-----------------------|---------------------|------------------|
| No. of Quarts <u>100</u> | <u>3580</u>           | Shot at <u>3630</u> | Feet _____       |
| No. of Quarts <u>250</u> |                       | Shot at <u>4080</u> | Feet <u>4270</u> |
| S/O <u>3952-62L</u>      | S/O <u>4148-2154L</u> | S/O _____           |                  |
| S/O <u>4079-84L</u>      | S/O <u>4169-69</u>    | S/O _____           |                  |

| DATE           |                                     | DATE          |                              |
|----------------|-------------------------------------|---------------|------------------------------|
| <u>8-11-40</u> | <u>L.O.C.</u>                       |               |                              |
| <u>8-21</u>    | <u>Q 440 R</u>                      | <u>11-20</u>  | <u>Q 3940L</u>               |
| <u>8-28</u>    | <u>T.D. 1080 WOC</u>                | <u>11-26</u>  | <u>Q 4060L</u>               |
| <u>9-4</u>     | <u>Q 1640X</u>                      |               | <u>SLM 4010-15</u>           |
| <u>9-10</u>    | <u>Q 2340 H</u>                     | <u>12-4</u>   | <u>Q 4270L</u>               |
| <u>9-18</u>    | <u>Q 2400 H</u>                     |               | <u>361 day Q 4270</u>        |
| <u>9-25</u>    | <u>Q 3380 H</u>                     |               | <u>300 OIH 12 hrs</u>        |
| <u>10-2</u>    | <u>T.D. 3450 H+L</u>                | <u>12-11</u>  | <u>T.D. 4275L</u>            |
|                | <u>Swaging Pipe</u>                 |               | <u>C.O.R.S</u>               |
|                | <u>pipe collapsed</u>               |               |                              |
| <u>10-9</u>    | <u>Q 3520 H+L</u>                   |               | <u>3000 OIH</u>              |
| <u>10-15</u>   | <u>T.D. 3695L</u>                   | <u>10-18</u>  | <u>T.D. 4275L</u>            |
| <u>10-23</u>   | <u>T.D. 3695L</u>                   |               | <u>Test</u>                  |
|                | <u>Q by at 3623-20</u>              | <u>DEC 30</u> | <u>T.D. 4280 45 BO 2 hrs</u> |
| <u>10-30</u>   | <u>T.D. 3695L</u>                   |               | <u>Flare open 2 1/2 hrs</u>  |
|                | <u>put bit in new hole</u>          |               | <u>750</u>                   |
|                | <u>Q by to 3630 (100-3580-3630)</u> |               |                              |
| <u>11-6</u>    | <u>now Q by @ 3640</u>              |               |                              |
| <u>11-13</u>   | <u>Q 3711L</u>                      |               |                              |
|                | <u>Q 3765L</u>                      |               |                              |

ILLEGIBLE

LOG

[illegible]