

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103
(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

Name of Company Murphy H. Baxter				Address 507 Midland National Bank Bldg. Midland, Texas		
Lease State "18-13"	Well No. 2	Unit Letter L	Section 18	Township 17-S	Range 33-E	
Date Work Performed 4-10-59	Pool Maljamar			County Lea		

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations ☒ Casing Test and Cement Job ☐ Other (Explain):
☐ Plugging ☐ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

Ran and cemented 139 joints & 1 pc. (4467.90') of 5½" 14# J-55 SRT ST&C new smls Spang casing @ 4476.9' w/150 sax HOWCO 4% Gel cement & 1200 gals. Dowell Cement. WOC 48 hours. Nippled up blow out preventors and drilled out cement to 4460'. Tested casing with 1500# for 30 minutes. Casing tested OK.

Witnessed by M. D. Lewis	Position Production Supt.	Company Murphy H. Baxter
------------------------------------	-------------------------------------	------------------------------------

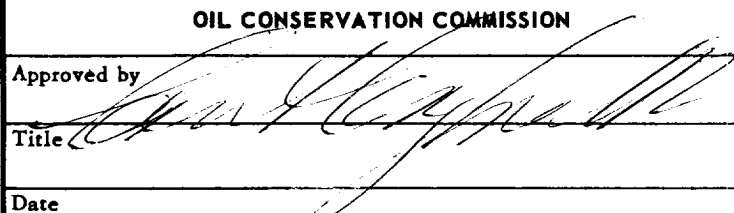
FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

D F Elev.	T D	P B T D	Producing Interval	Completion Date
Tubing Diameter	Tubing Depth	Oil String Diameter	Oil String Depth	
Perforated Interval(s)				
Open Hole Interval		Producing Formation(s)		

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover						
After Workover						

OIL CONSERVATION COMMISSION		I hereby certify that the information given above is true and complete to the best of my knowledge.	
Approved by 	Name J. J. McMillan		
Title Petroleum Engineer	Position Petroleum Engineer		
Date	Company Murphy H. Baxter		