

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
1625 N. French Dr.
Hobbs, NM 88240
APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993
Lease Designation and Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other **Injection Well**

2. Name of Operator

Conoco Inc

3. Address and Telephone No.

10 DESTA DR. STE. 100W, MIDLAND, TX 79705-4500 (915) 686-5580

4. Location of Well (Footage. Sec., T. R. M. or Survey Description)

1980' FNL & 660' FEL, Sec. 20, T17S, R32E, H

LC 029405A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8920003410

8. Well Name and No.

MCA Unit #48

9. API Well No.

30-025-08054

10. Field and Pool, or Exploratory Area

Maljamar Grayburg/SA

11. County or Parish, State

Lea, NM

CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other **Repair Tubing Leak/Run MIT**
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

10/25/99 Drove to location; shut down.

10/26/99 Held pre-job safety meeting. Started to rig up and found tee sill broken; called for replacement. Rigged up on new tee sill. Rigged up ICO and scanned tubing out of hole. 112 yellow, 2 blue, 1 green, 3 red. Found hole in the 100th jt. Hole looked like internal corrosion just below the upset, coating may have cracked. Rigged down ICO, SDON.

10/27/99 Held pre-job safety meeting. Picked up packer and ran in well. Set packer to test; unable to keep packer set, layed down one jt. Circulated packer fluid and set packer with 20 points tension. Nippled down BOP, flanged up well. Tested casing @ 690# for 15 minutes (chart attached). Rigged down.

Well was returned to injection.

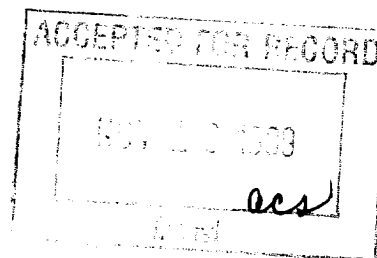

14. I hereby certify that the foregoing is true and correct

Signed

Reesa Wilkes

Title

Reesa R. Wilkes

Sr. Staff Regulatory Assistant

Date

11/04/99

(This space for Federal or State office use)

ORIGINAL SIGNED BY CHRIS WILLIAMS
DISTRICT SUPERVISOR

Approved by

Conditions of approval if any:


Title

NOV 24 1999

BLM(6), NMOC(1), SHEAR, PONCA, COST ASST, FILE ROOM, FIELD

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

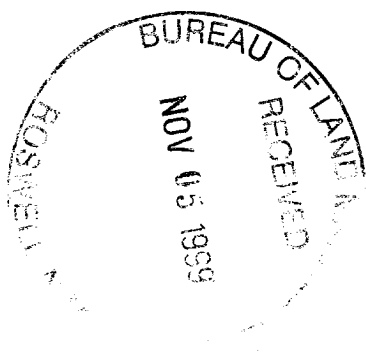

100
100
100

