

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103
(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

Name of Company Carper Drilling Company, Inc.				Address Artesia, New Mexico			
Lease Carper-State "A"	Well No. 6	Unit Letter I	Section 32	Township 17 S	Range 33 E		
Date Work Performed 12-2-61	Pool Undesignated			County Lea			

THIS IS A REPORT OF: (Check appropriate block)

- Beginning Drilling Operations
 Casing Test and Cement Job
 Other (Explain):
 Plugging
 Remedial Work
 Perforating & Fracturing

Detailed account of work done, nature and quantity of materials used, and results obtained.

T.D. 4748'
P.B.T.D. 4708'
Ran Schlumberger Gamma Ray tie in log
Perforated from 4602'-4620'; 4629'-4645' with 2 jets per foot.
Spotted 200 gallons MCA across perforations.
Fractured with 18,000 gallons lease crude plus 30,000 lbs. sand
After recovery of all load, well flowed 100 barrels oil plus 11 barrels water per day.

Witnessed by Clark Storm	Position Prod. Supt.	Company Carper Drilling Company, Inc.
------------------------------------	--------------------------------	---

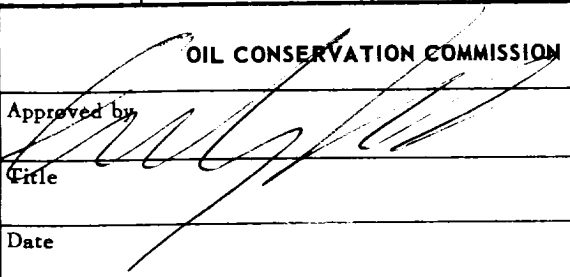
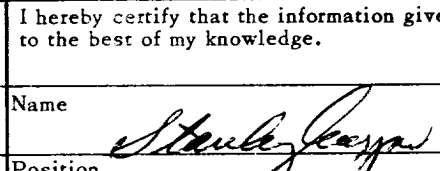
FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

D F Elev.	T D	P B T D	Producing Interval	Completion Date
Tubing Diameter	Tubing Depth	Oil String Diameter	Oil String Depth	
Perforated Interval(s)				
Open Hole Interval			Producing Formation(s)	

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover						
After Workover						

<p>OIL CONSERVATION COMMISSION</p> <p>Approved by </p> <p>Title</p> <p>Date</p>		<p>I hereby certify that the information given above is true and complete to the best of my knowledge.</p> <p>Name </p> <p>Position Exec. Vice-Pres.</p> <p>Company Carper Drilling Company, Inc.</p>
---	--	---