

N. M. STATE COMMISSION
P. O. BOX 1300
HOBBS, NEW MEXICO 88240

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☒ gas well ☐ other ☐
2. NAME OF OPERATOR
Dorchester Gas Corporation
3. ADDRESS OF OPERATOR
P. O. Box 96, Hobbs, New Mexico 88240
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980' FNL & 660' FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


- | REQUEST FOR APPROVAL TO: | | SUBSEQUENT REPORT OF: |
|--------------------------|--------------------------|-------------------------------------|
| TEST WATER SHUT-OFF | <input type="checkbox"/> | <input type="checkbox"/> |
| FRACTURE TREAT | <input type="checkbox"/> | <input type="checkbox"/> |
| SHOOT OR ACIDIZE | <input type="checkbox"/> | <input type="checkbox"/> |
| REPAIR WELL | <input type="checkbox"/> | <input type="checkbox"/> |
| PULL OR ALTER CASING | <input type="checkbox"/> | <input type="checkbox"/> |
| MULTIPLE COMPLETE | <input type="checkbox"/> | <input type="checkbox"/> |
| CHANGE ZONES | <input type="checkbox"/> | <input type="checkbox"/> |
| ABANDON* | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| (other) | | Temporarily |

5. LEASE
NM-0175774
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
Plains Operating Area
8. FARM OR LEASE NAME
Plains Operating Area
9. WELL NO.
6
10. FIELD OR WILDCAT NAME
Lusk Strawn
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 21, T. 19 S., R. 32 E.
12. COUNTY OR PARISH
Lea
13. STATE
New Mexico
14. API NO.
30-025-20769
15. ELEVATIONS (SHOW DF, KDB, AND WD)
3602 RDB

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

March 10-15 Pulled rods, pump and tbq. Flanged up wellhead and temporarily abandoned per approval granted February 8, 1982. Tbg anchor was stuck in hole, chemically cut tbq at 11125' left fish in hole consisting of 15' of 2 3/8" N-80 tbq smooth cut, Baker 5 1/2" x 2 3/8" tbq anchor, 6 jts of 2 3/8" N-80 tbq, 2 3/8" x 12" SN, 2 3/8" x 3' PN, 2 jts of 2 3/8" N-80 mud anchor bull plugged.

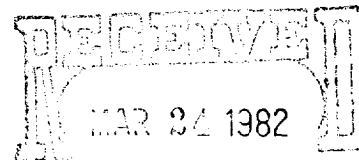

Subsurface Safety Valve: Manu. and Type _____

Set @ _____

18. I hereby certify that the foregoing is true and correct

SIGNED Steve Collins TITLE District Engineer DATE March 23, 1982

APPROVED BY PETER W. CHESTER TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

APR 2 1982

**U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO**

*See Instructions on Reverse Side

RECEIVED
JAN 15 1982

JAN 15 1982

U.S. DEPARTMENT OF JUSTICE
FEDERAL BUREAU OF INVESTIGATION
WASHINGTON, D.C. 20535