

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division

P.O. Box 380
Hobbs, NM 88240

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

RECEIVED

Agency Designation and Serial No.

NMILC 029489B

6. If Indian, Alibates or Tribe Name

97

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

OXY USA Inc.

16696

3. Address and Telephone No.

P.O. Box 50250 Midland, TX 79710-0250

915-685-5717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660 FSL 510 FWL SWSW (M) Sec 4 T18S R33E

7. If Unit or CA, Agreement Designation

L, NM

8. Well Name and No.

Federal AE #14

9. API Well No.

30-025-33366

10. Field and Pool, or Exploratory Area

Undesignated Bone Springs

11. County or Parish, State

Lea NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION


- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Completion & TA Status
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

TD - 12000' PBD - 10662'

See Other Side

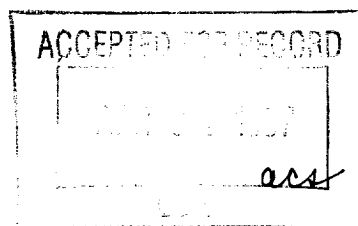

14. I hereby certify that the foregoing is true and correct

Signed

David Stewart

Title

David Stewart
Regulatory Analyst

Date

4/2/97

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

pool added

ATTACHMENT 3160-5
OXY USA INC.
FEDERAL AE #14
SEC 4 T188 R33E
LEA COUNTY, NM

MIRU PU 7/29/96, NUBOP, NDWH, RIH & TAG @ 11953', TEST CSG TO 1500#, HELD OK. RIH W/ CBL. PERF WOLFCAMP W/ 1SPF @ 11281-11324', TOTAL 39 HOLES. RIH W/ RTTS PKR & SET @ 11211'. ACIDIZE WOLFCAMP W/ 3000gal 15% NEFE HCL ACID, MAXP-5600#, ISIP-5100#. OPEN WELL TO PIT & FLOWED 3-BW IN 30min & DIED. 13hr SITP-750#, OPEN WELL & DIED IN 1min. SWAB TRACE OF OIL, 71-BW, GOOD SHOW OF GAS IN 13hrs. 12hr SITP-140#, OPEN WELL & BURN FLARE FOR 10min & DIED. SWAB TRACE OF OIL, 14-BW, GOOD SHOW OF GAS IN 7hrs. 13hr SITP-80#, SWAB TRACE OF OIL, 3-BW, IN 1-1/2hrs. REL PKR & POOH, RIH W/ CIBP & SET @ 11250, TEST CSG TO 1200#, HELD OK, DUMP 5sx (35') CMT ON TOP., POOH.

PERF WOLFCAMP W/ 1SPF @ 10737-747, 783-787, 791-803, 819-823, 835-838, 862-868, 889-10914', TOTAL 71 HOLES. RIH & SET RTTS PKR @ 10677'. SWAB 0-BO, 34-BW, IN 3hrs, NO SHOW OF OIL OR GAS. 12hr SITP-0#, SWAB 0-BO, 135-BW, IN 11hrs, NO SHOW OF OIL OR GAS. 13hr SITP-0#, SWAB 0-BO, 158-BW, IN 8hrs, NO SHOW OF OIL OR GAS. 12hr SITP-6#, SWAB 0-BO, 299-BW, IN 13hrs, NO SHOW OF OIL OR GAS. 30hr SITP-0#, SWAB 0-BO, 256-BW, IN 12hrs, NO SHOW OF OIL OR GAS. REL PKR & POOH, RIH W/ CIBP & SET @ 10697, TEST CSG TO 1500#, HELD OK, DUMP 5sx (35') CMT ON TOP., POOH.

PERF BONE SPRINGS W/ 1SPF @ 6710-18, 47-54, 72-84, 91-6796, 6818-35, 41-48, 53-65, 6885-6906', TOTAL 97 HOLES. RIH & SET RTTS PKR @ 6658'. SWAB 0-BO, 46-BW, IN 2hrs, NO SHOW OF OIL OR GAS. 13hr SITP-0#, SWAB 0-BO, 389-BW, IN 14hrs, NO SHOW OF OIL OR GAS. 13hr SITP-0#, SWAB 0-BO, 380-BW, IN 14hrs, NO SHOW OF OIL OR GAS. 11hr SITP-0#, SWAB 0-BO, 318-BW, IN 12hrs, NO SHOW OF OIL OR GAS. 30hr SITP-5#, SWAB 0-BO, 365-BW, IN 13hrs, NO SHOW OF OIL OR GAS. 12hr SITP-0#, SWAB 0-BO, 295-BW, IN 12hrs, NO SHOW OF OIL OR GAS. 12hr SITP-0#, SWAB 0-BO, 75-BW, IN 3hrs, NO SHOW OF OIL OR GAS. REL PKR & POOH W/ PKR & TBG, RDPD 8/21/96, CLEAN LOCATION, SI & TA WELL PENDING ENGR EVAL.

Received
Harris
11/10