

Step Rate Injection Test Report

for

Texaco E&P

CVU 294

10/01/01

N- 6-18s-35e
3D-025-35398

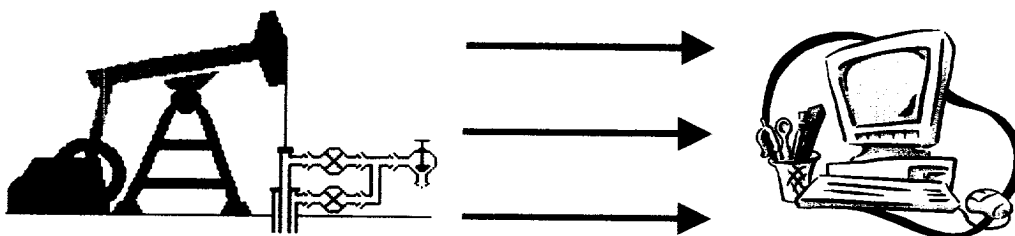


TABLE OF CONTENTS

SECTION I	CONTENTS
SECTION II	SEQUENCE OF EVENTS
SECTION III	DATA REPORT
SECTION IV	CHART



COMPANY : Texaco E&P
WELL: CVU 294
COMPANY REP: Steve Guillot
PERFORATIONS: N/A

N/A

SERVICE DATES : 10/01/01
TEST TYPE : Step Rate Injection
PPS TECHNICIANS : D. Ginanni
BHP GAUGE DEPTH: N/A

10/01/01	9:30	Start Pumping @ 500 BPD
10/01/01	9:45	Increase to 1000 BPD
10/01/01	10:00	Increase to 1500 BPD
10/01/01	10:15	Increase to 2000 BPD
10/01/01	10:30	Increase to 2500 BPD
10/01/01	10:45	Increase to 3000 BPD
10/01/01	11:00	Increase to 3500 BPD
10/01/01	11:15	Increase to 4000 BPD
10/01/01	11:30	Increase to 4500 BPD
10/01/01	11:45	Increase to 5000 BPD
10/01/01	12:00	Increase to 5500 BPD
10/01/01	12:15	Cease pumping, start falloff
10/01/01	12:30	End of test



COMPANY : Texaco E&P
 WELL: CVU 294
 COMPANY REP: Steve Guillot
 PERFORATIONS: N/A

SERVICE DATES : 10/01/01
 TEST TYPE : Step Rate Injection
 PPS TECHNICIANS : D. Ginanni
 BHP GAUGE DEPTH: N/A

	9:30	207.1				
	9:35	223.8	1.6	464.5	13.55	
	9:40	232.7	3.3	476.9	13.91	
1	9:45	254.1	4.9	475.0	13.85	
	9:50	326.1	8.3	972.6	28.37	
	9:55	349.7	11.8	1019.5	29.74	
2	10:00	370.2	15.4	1018.2	29.70	
	10:05	495.3	20.5	1466.9	42.79	
	10:10	498.4	25.7	1500.8	43.77	
3	10:15	555.4	30.9	1508.7	44.00	
	10:20	629.0	37.6	1920.7	56.02	
	10:25	671.7	44.5	1994.2	58.16	
4	10:30	648.9	51.4	1992.9	58.13	
	10:35	729.0	59.6	2358.2	68.78	
	10:40	762.0	68.2	2481.4	72.38	
5	10:45	796.1	76.8	2478.9	72.30	
	10:50	878.8	86.9	2888.5	84.25	
	10:55	957.2	97.2	2978.0	86.86	
6	11:00	975.1	107.5	2974.9	86.77	
	11:05	1075.4	119.5	3451.7	100.67	
	11:10	1123.8	131.7	3494.4	101.92	
7	11:15	1140.0	143.8	3501.4	102.12	
	11:20	1228.0	157.3	3882.9	113.25	
	11:25	1288.9	170.9	3906.1	113.93	
8	11:30	1296.5	184.5	3916.0	114.22	
	11:35	1421.3	199.7	4379.0	127.72	
	11:40	1425.4	215.0	4427.8	129.15	
9	11:45	1472.8	230.4	4429.4	129.19	
	11:50	1598.5	247.4	4885.5	142.49	
	11:55	1619.2	264.6	4947.3	144.30	
10	12:00	1652.3	281.7	4943.9	144.20	
	12:05	1755.4	300.3	5353.1	156.13	
	12:10	1788.3	319.1	5404.2	157.62	



COMPANY : **Texaco E&P**
WELL: **CVU 294**
COMPANY REP: **Steve Guillot**
PERFORATIONS: **N/A**


SERVICE DATES : **10/01/01**
TEST TYPE : **Step Rate Injection**
PPS TECHNICIANS : **D. Ginanni**
BHP GAUGE DEPTH: **N/A**

11	12:15	1839.7	337.9	5418.4	158.04	
FALLOFF	12:16	1272.7				
	12:17	1227.0				
	12:18	1175.9				
	12:19	1137.6				
	12:20	1106.3				
	12:25	1000.8				
	12:30	933.9				
	12:30	932.0				
	12:30	930.4				
	12:30	928.5				
	12:30	926.9				
	12:30	925.1				

Pacific PROCESS SYSTEMS, INC.

TEXACO EI, BUCKEYE CVU 294

Step Rate Injection Test

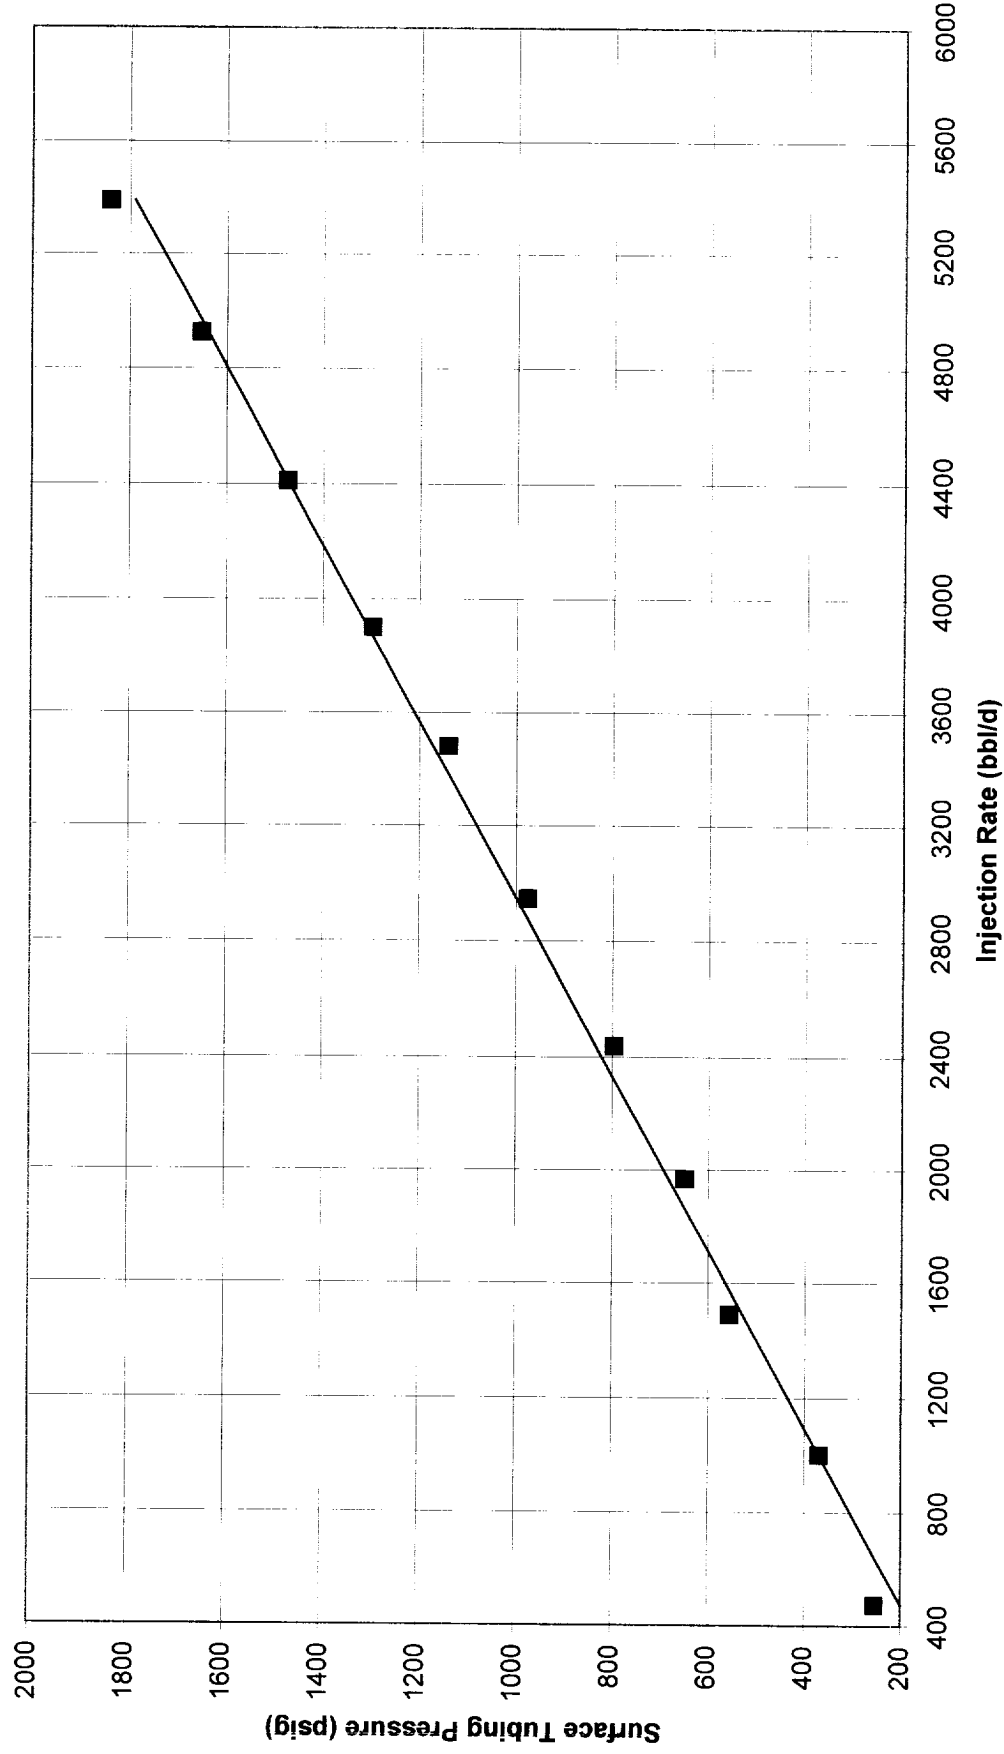

Phone: (505) 392-8813
Fax: (505) 392-6612

3406 Lovington Hwy.
Hobbs, NM 88240