

RICKS EXPLORATION INC.

State VII #1

Sec. 1-17S-34E

Lea Co., NM


Spud Date: 9/02/01

Proposed 8 5/8" casing repair

GL: 4033'

DF: 4052'

KB: 4053'

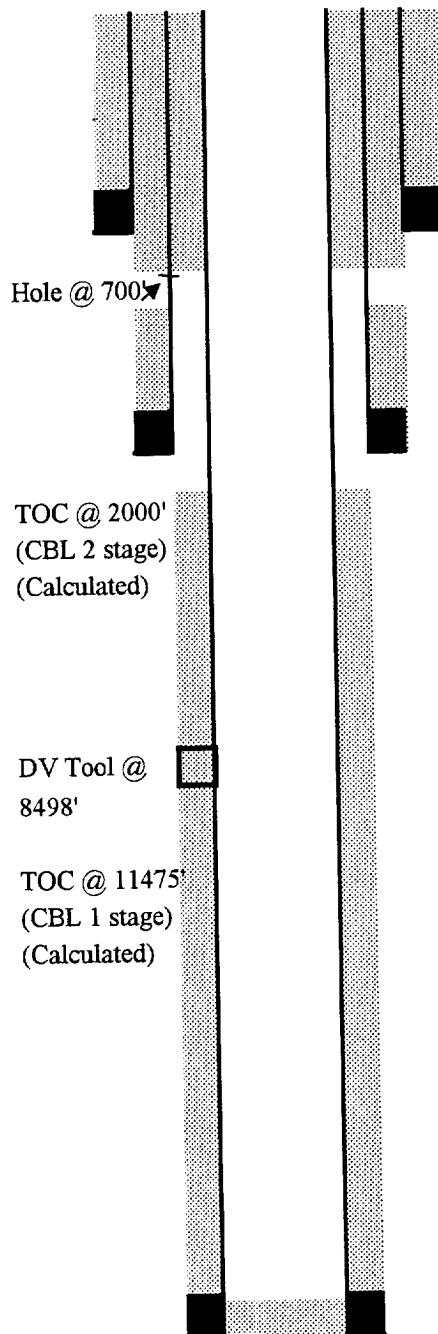

SURFACE CASING:

11-3/4" 42# H40 set @ 1610'

CMT w/ 790 sxs to surf

INTERMEDIATE CASING:

8-5/8" 32# K-55 set @ 5020'

CMT w/ 1190 sxs. Did not circ to surf.

TOC @ 1740' (Temp Survey)

Hole indicated in 8 5/8" @ 700'

Pump Cl C neat cmt dn 4 1/2" X 8 5/8" annulus until cmt returns to sfc
Est 300 sx

ATOKA PERFORATIONS

11528' - 11553' 4/SPF (1/93)

Loc set Pkr @ 11682' w/ on/off tool & plug set in R nipple @ 11750'
(4" TCP gun in hole)

11902' - 11914' 4/SPF (2/83)

PRODUCTION CASING:

4-1/2" 11.6# P110 LT&C @ 12732'

Cement w/ 1380 sx

PBTD: 12722'

TD: 12750'

BJR 11/12/01

