


APPROVED

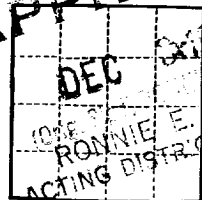

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Albuquerque
Lease No. 073240
Unit A

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. Signal Ross #5 is located 330 ft. from N line and 990 ft. from E line of sec. 30
NE/4 NE/4 Sec. 30 19S 33E N.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
South Tonto-Yates Lee New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On Nov. 26, 1962, we reached total depth at 3005'. Water was encountered at 2995 to T.O. Water filled up 800' in hole in 1 hour. We propose to plug well as follows:

35 sacks cement at 3001' to 2901'.
35 sacks cement at 2780' to 2680'.
35 sacks cement at 1380' to 1280'.
50 sacks cement at 620' to 520'.
16 sacks cement at 20' to surface.

Verbal approval was given by Mr. Knauf on November 26.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Perry R. Bass - Little Eddy Unit
William A. & Edward R. Hudson, Agent

Address 302 Carper Building
Artesia, New Mexico

By Ralph L. Gray
Title Consulting Engineer