


## OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

## MISCELLANEOUS REPORTS ON WELLS

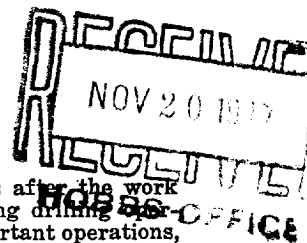

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut-off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below:

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	X		

Hobbs, New Mexico  
Place11-19-47  
DateOIL CONSERVATION COMMISSION,  
SANTA FE, NEW MEXICO.

Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the

Phillips Petroleum Company Santa Fe Well No. 37 in the  
Company or Operator Lease  
NW/4 of Sec. 28, T. 17-S, R. 35-E, N. M. P. M.,  
Vacuum Field, Lea County.

The dates of this work were as follows: 11-4-47 to 11-11-47

Notice of intention to do the work was (~~was not~~) submitted on Form C-102 on 10-8 19 47  
and approval of the proposed plan was (~~was not~~) obtained. (Cross out incorrect words.)

## DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

11-4-47 T.D. 4671' Cecil Penick, Contractor, moved in and rigged up to plug well.  
11-5-47 Loaded hole with mud. Placed 20 sacks cement 4101'-4202'.  
11-6-47 Lost cement plug 4101'-4202'. Placed 10 sacks cement 4150'-4200'.  
11-7-47 Shot 7" casing at 2850', 2750', 2600', 2500', and 2400'. Pipe came loose at 2400'.  
11-8-47 Pulling 7" casing. 11-9-47 Pulling 7" casing.  
11-10-47 Completed pulling casing, total recovery 81 joints, 2414'.  
11-11-47 Filled hole with heavy mud and filled top 10' in 9-5/8" casing with cement. Set 4" pipe marker in casing, well plug and abandoned.

Witnessed by D. M. Barton Phillips Petroleum Company Lease Foreman  
Name Company Title

Subscribed and sworn before me this 19

I hereby swear or affirm that the information given above is true and correct.

day of NOV., 19 47

Name *M. D. Knight*

Position District Chief Clerk

Representing Phillips Petroleum Company  
Company or Operator

My commission expires

Address Hobbs, New Mexico Box 1605

Remarks:

APPROVED

OIL &amp; GAS INSPECTOR

Title

NOV 19 1947