

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103

Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO.

30-025-20748

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

Warn State A/C 1

8. Well No.

3

9. Pool name or Wildcat

N.Vac. Abo/Vac. Upper Perm/Wolfcamp

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Marathon Oil Company

3. Address of Operator

PO Box 2490 Hobbs, NM 88240

4. Well Location

Unit Letter F: 2080 feet from the North line and 1908 feet from the West line

Section 31 Township 17S Range 35E NMPM County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

GL 3975' KB 3989'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: Try & retrieve fish from 2 7/8" csg / PA ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Marathon Oil Company attempted to fish out tubing and rods from the original Wolfcamp casing.
Please see attached sheet.

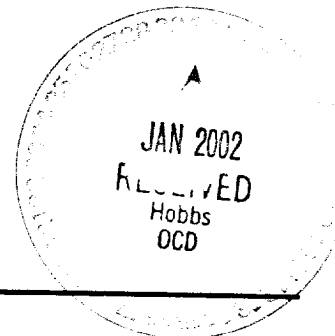

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kelly Cook TITLE Admin. Assistant DATE 1/30/02

Type or print name Kelly Cook

Telephone No. 393-7106

(This space for State use)

APPROVED BY _____ TITLE ORIGINAL SIGNED BY DATE FEB 04 2002
Conditions of approval, if any: PAUL F. KAUTZ
PETROLEUM ENGINEER

Marathon Oil Corp.
Warn State A/C 1 #3
API No. 30-025-20748
C-103 Attachment
January 30, 2002

(1/14/02)

MIRU PU. Blow all three strings down & kill well with 2% KCl. ND triple split hanger & wellhead. NU triple hanger adaptor & BOPE.

(1/15/02)

Pick up 1-1/4" drill pipe and TIH with impression block. Tag top of fish at 250'. POOH. Impression of 5/8" pins. RIH w/ 5/8" box on drill pipe. Unable to catch fish. POOH. Box full of paraffin and pieces of metal. RIH w/ 5/8" box and 2' bent rod sub. Unable to catch fish. POOH. Paraffin & piece of metal inside box. Piece of metal matched part of 5/8" circle on block. RIH w/ overshot & 1-1/4" grapple. Unable to catch fish. POOH. Overshot full of paraffin. RIH w/ overshot and grapple. Unable to catch fish. POOH. Bottom of overshot marked on lip ID all the way around. RIH w/ 2-1/4" impression block. Set down on fish. POOH. Block indicated 2" circle. RIH w/ 1-5/8" spear. Attempt to get inside tubing. Unable to catch fish. POOH.

(1/16/02)

RIH w/ 2-5/16" flat bottom mill. RU power swivel. Broke circulation. Cut and drilled on 1.9" OD tubing upset. POOH. RIH w/ overshot & 1.9" grapple. Caught fish. Pulled 8 pts. Fish came loose. POOH. Grapple broken. RIH w/ 2-1/4" impression block. Tag fish. POOH. Block indicated partial 2" circle. RIH w/ overshot & 1.97" grapple. Caught fish but grapple slipping off. POOH. Grapple broken. RIH w/ overshot & 1.875" grapple. Unable to catch fish. POOH. Grapple broken. RIH w/ 2-5/16" box tap and bumper sub. Tag fish. Screwed onto fish. Pull 2 pts. Box tap came loose. POOH. Recovered piece of grapple and a piece of split 1.9" tubing. RIH w/ box tap and bumper sub. Attempt to latch onto fish, but could not. POOH. Did not recover anything.

(1/17/02)

RIH w/ 2-5/16" box tap. Tag fish. Unable to catch fish. POOH. Recover nothing. RIH w/ 2-5/16" flat bottom mill. RU power swivel. Broke circulation. Cut and drilled on 1.9" tubing. POOH. Mill bottom had partial circle. RIH w/ 2-1/4" impression block. Sat down on fish. POOH. Block had gouges on center of block but no circle. Made 5 runs with box tap. Run # 1: Unable to catch fish. POOH. Had piece of grapple in box tap. Run # 2: Caught fish. Pulled 8 pts. Pulled off tubing. POOH. Recover nothing. Run # 3: Caught fish. Pulled 10 pts. Pulled off tubing. POOH. Recover nothing. Run # 4: Caught fish. Pulled 17 pts. Pulled off tubing. POOH. Recover nothing. Run # 5: Caught fish. Pulled 20 pts. Box tap free. POOH. Left box tap in hole. Threads on pin pulled out of box.

(1/18/02)

RIH w/ 3/4" pin and bumper sub. Screwed into fish. Box tap still latched onto fish. Pulled 20 pts. Pulled off fish. POOH. Recovered box tap. RIH w/ 2-5/16" box tap and bumper sub. Latched onto fish. Pulled 20 pts. Pulled off fish. POOH. Recover nothing. Pumped 15 bbls water down 2-7/8" casing. Pumping 1.5 BPM @ 400 psi. RIH w/ box tap and bumper sub. Screwed onto fish. Pulled 20 pts. Pulled off fish. POOH. Recover nothing. RIH w/ box tap on drill pipe. Screwed onto fish. Pulled 20 pts. Pulled off fish. POOH. ND BOPE. NU triple tubing hanger flange and wellhead. RDMO PU.

JAN 2002
RECEIVED
HOOB
DOD