

# N. M. OIL CONS. COMMISSION

P. O. BOX 1930

HOBBS, NEW MEXICO 88240

Form 9-331  
Dec. 1973

Form Approved.  
Budget Bureau No. 42-R1424

## UNITED STATES DEPARTMENT OF THE INTERIOR GEOLOGICAL SURVEY

### SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ well gas ☐ well other ☐
2. NAME OF OPERATOR  
Harvey E. Yates Company
3. ADDRESS OF OPERATOR  
P. O. Box 1933, Roswell, New Mexico 88201
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 660' FSL & 660' FWL  
AT TOP PROD. INTERVAL:  
AT TOTAL DEPTH: Same
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO: SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐ ☐

FRACTURE TREAT ☐ ☐

SHOOT OR ACIDIZE ☐ ☐

REPAIR WELL ☐ ☐

PULL OR ALTER CASING ☐ ☐

MULTIPLE COMPLETE ☐ ☐

CHANGE ZONES ☐ ☐

ABANDON\* ☐ ☐

(other) 4 1/2" Production Casing & Casing Test

5. LEASE  
NM 11118
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME  
Young Deep Unit
8. FARM OR LEASE NAME
9. WELL NO.  
7
10. FIELD OR WILDCAT NAME  
North Young Bone Spring
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Section 3, T-18S, R-32E
12. COUNTY OR PARISH 13. STATE  
Lea NM
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)  
3853.6 CR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*


10/2/81 Depth-9576. Run Production Casing: Ran:

24 jts	4 1/2	11.6#	LT & C	N-80	970.23
53 jts	4 1/2	11.6#	LT & C	J-55	2115.98
38 jts	4 1/2	11.5#	ST & C	J-55	3548.65
36 jts	4 1/2	11.6#	LT & C	J-55	1452.65
38 jts	4 1/2	11.6#	LT & C	N-80	1535.98
239 jts					9623.49

Set @ 9576'

Cement:

530 sx "H" .5% CFR-2, .5% Halad 22-A 4.3# Salt  
PD @ 12:30 P. M. 10/1/81 w/1800 psi

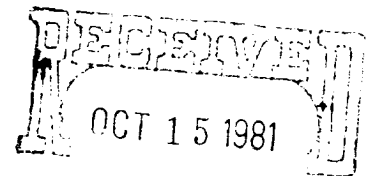

OIL & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED ROGER A. CHAPMAN TITLE Engineer DATE October 14, 1981

(This space for Federal or State office use)

APPROVED BY OCT 15 1981 TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY

U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO