

BENNETT-CATHEY WIRE LINE SERVICE

P.O. BOX 787
 ARTESIA, NEW MEXICO 88210
 Phone (505) 746-3281


BOTTOM HOLE PRESSURE SURVEY REPORT



OPERATOR MORILLO
 LEASE STIVASON FED
 WELL NO. 1
 POOL FORMATION SEVEN RIVERS
 DATE 4-25-85 TIME _____
 CO. MAN _____
 STATUS SHUT IN TEST DEPTH
 TIME S.I. _____
 BHP LAST TEST _____
 BHP CHANGE _____
 TUB. PRES. 1345.2
 CAS. PRES. _____
 FLUID TOP _____
 WATER TOP _____
 DATUM PLANE _____
 DATUM PSIA 1513.2 RUN BY STEVE SILVEIRA
 TEMP 114° CLOCK # B3443
 PRESSURE RANGE 8000
 ELEMENT NO. RP3#21034

DEPTH	PRESSURE	GRADIENT
0	1345.2	4.0
1000	1385.2	4.0
1500	1405.2	4.0
2000	1424.2	3.8
2500	1446.2	4.4
3685	1495.2	5.8
3835	1507.2	8.0
3911	1513.2	7.9

3911 FEET WAS EXTRAPOLATED
 TIME B.H.P. MEASURED 0925 HRS
 LENGTH OF TIME WELL SHUT IN N/A
 PERFORATIONS FROM 3909-3914

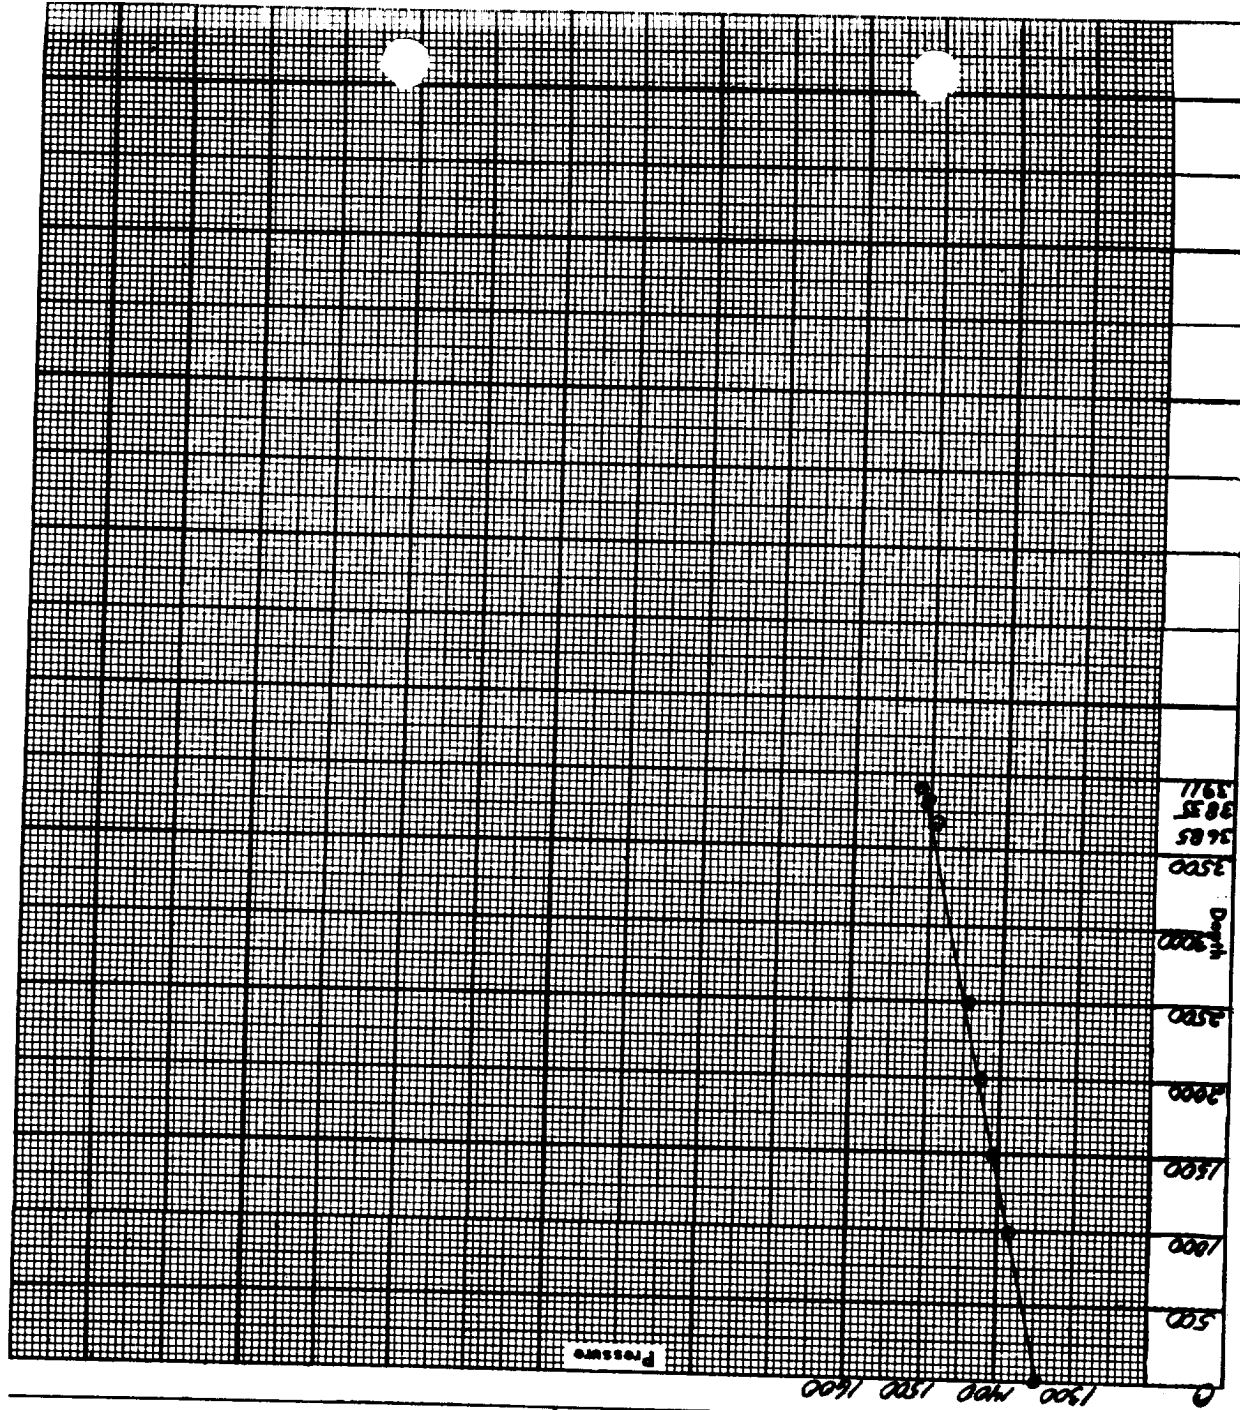

RECEIVED

MAY 14 1985

**O.C.D.
HOBBS OFFICE**