

SUB-SURFACE
DIRECTIONAL
SURVEY
REPORT

AMOCO PRODUCTION COMPANY
COMPANY

SHU #157
WELL NAME

LEA COUNTY, NEW MEXICO
STATE AND COUNTY

CERTIFIED REPORT

CUSTOMER : AMOCO PRODUCTION COMPANY

ELL # : SHU NO. 157

LOCATION : LEA COUNTY, NEW MEXICO

DATE : 11/22/83, 11/26/83, (EW) 11/30/83

OB TYPE : MNS, MNS, (EW) MNS

OB # : MS-1326, MS-1335, (EW) 90167

SURVEYOR : A. HARBERT, R. RICE, (EW) G. DESPAIN

DEPTH : 0'-1484', 1484'-3621', 3621'-4250'

ECL. : 10 DEGREES EAST

LEV. : 0'

FILE # : WT-FBS

METHOD : RADIUS OF CURVATURE

SECTION : 94SE

FINAL STATION DATA:

THIS SURVEY IS CORRECT TO THE
BEST OF MY KNOWLEDGE AND IS
SUPPORTED BY ACTUAL FIELD DATA.

Larry Massey
DIO REPRESENTATIVE

MEASURED #	INCL. #	HOLE #	COURSE #	VERTICAL #	TRUE #	RECTANGULAR C L O S U R E	DUG-LEG
DEPTH	ANGL.	DIRECTION	LENGTH	DEPTH	SECTION	C O O R D I N A T E S	DISTANCE
FEET	DEGS.	DEGS.	FEET	FEET	FEET	FEET	DEGS.
4250.00	1.50	5 5 12.00 E	62.00	4249.10	52.30	23.76 S	50.20 E
							55.54 at S 64.60 E
							.40

MEASURED	INCL. ANGLE	TRUE	COURSE	VERTICAL	VERTICAL	RECTANGULAR	C L O S U R E	DISTANCE	DIRECTION	SEVERITY	DUG-LEG
DEPTH	DEGS.	DEGS.	LENGTH	FEET	FEET	COORDINATES	FEET	FEET	WGS84		
0.00	0.00	N 00.00 E	0.00	0.00	0.00	0.00 N	0.00 E	0.00at	N 00.00 E		0.00
01.00	0.00	N 00.00 E	01.00	01.00	01.00	0.00 N	0.00 E	0.00at	N 00.00 E		0.00
132.00	.25	S 72.00 W	61.00	132.00	-06.41	.04 S	.13 W	.13at	S 72.00 W		.41
203.00	.25	N 64.00 W	61.00	203.00	-26.33	.02 S	.39 W	.39at	S 66.58 W		.31
264.00	1.00	N 70.00 W	61.00	264.00	-07.87	.24 N	1.00 W	1.00at	N 76.61 W		1.23
325.00	.75	N 65.00 W	61.00	325.00	-17.33	.59 N	1.06 W	1.95at	N 72.20 W		.43
386.00	.25	S 71.00 W	61.00	386.00	-21.12	.62 N	2.30 W	2.46at	N 76.37 W		.98
447.00	.50	S 41.00 W	61.00	447.00	-21.19	.40 N	2.70 W	2.73at	N 81.57 W		.51
508.00	.50	S 52.00 W	61.00	508.00	-21.21	.03 N	3.09 W	3.09at	N 89.37 W		.16
569.00	.50	S 54.00 W	61.00	569.00	-21.20	.29 S	3.51 W	3.53at	S 85.33 W		.03
630.00	.25	S 48.00 W	61.00	630.00	-21.30	.56 S	3.81 W	3.85at	S 81.65 W		.43
691.00	.50	S 68.00 W	61.00	691.00	-21.36	.79 S	4.13 W	4.20at	S 79.15 W		.50
752.00	.25	S 14.00 W	61.00	752.00	-21.33	1.00 S	4.38 W	4.51at	S 76.12 W		.67
813.00	.75	S 20.00 W	61.00	813.00	-21.08	1.59 S	4.53 W	4.80at	S 78.67 W		.82
874.00	0.00	N 00.00 E	61.00	874.00	-11.91	1.96 S	4.67 W	5.07at	S 67.18 W		1.23
935.00	.50	S 11.00 E	61.00	935.00	-11.00	2.73 S	4.61 W	5.13at	S 65.00 W		.82
996.00	.25	S 16.00 E	61.00	996.00	-11.35	2.61 S	4.52 W	5.22at	S 59.77 W		.41
1057.00	0.00	N 00.00 E	61.00	1057.00	-11.21	2.74 S	4.59 W	5.27at	S 59.61 W		.41
1118.00	0.00	N 00.00 E	61.00	1118.00	-11.24	2.74 S	4.50 W	5.27at	S 58.61 W		0.00
1179.00	.25	S 46.00 W	61.00	1179.00	-11.24	2.84 S	4.60 W	5.40at	S 58.31 W		.41
1240.00	.75	S 43.00 E	61.00	1240.00	-11.01	3.32 S	4.61 W	5.58at	S 54.25 W		1.29
1301.00	0.00	N 00.00 E	61.00	1301.00	-11.51	3.61 S	4.34 W	5.64at	S 50.22 W		1.23
1362.00	0.00	N 00.00 E	61.00	1362.00	-11.51	3.61 S	4.34 W	5.64at	S 50.22 W		0.00
1423.00	.25	S 60.00 E	61.00	1423.00	-11.39	3.68 S	4.22 W	5.60at	S 49.94 W		.41
1484.00	.25	S 60.00 E	61.00	1484.00	-11.13	3.79 S	3.98 W	5.50at	S 46.39 W		.06

(01-1484' RESULT OF DIC SURVEY MS-1326)
(1484/-3621' RESULT OF DIC SURVEY MS-1330)

1. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 2. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 3. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 4. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 5. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 6. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 7. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 8. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 9. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。
 10. 本表係根據測量員之報告而編製，其內容之正確與否，概與本局無涉。

MEASURED	INCL.	HOLE	COURSE	TRUE	VERTICAL	SECTION	RECTANGULAR	C	L	O	S	U	R	E	DUG-LEG
DEPTH	ANGLE	DIRECTION	LENGTH	DEPTH	FEET	FEET	COORDINATES	FEET	FEET	FEET	FEET	FEET	FEET	FEET	FEET
FEET	DEGS.	DEGS.	FEET	FEET	FEET	FEET	N/S	E/W	FLFT	FLFT	FLFT	FLFT	FLFT	FLFT	FLFT
1576.00	1.75	S 49.00 E	22.00	1575.96	64	4.21 S	3.30 W	5.35at S	38.09 W						.57
1637.00	.50	S 80.00 W	61.00	1636.96	91	4.72 S	3.44 W	5.85at S	36.08 W						1.86
1699.00	.50	N 65.00 E	62.00	1698.95	58	4.37 S	3.55 W	5.63at S	39.13 W						1.60
1761.00	1.00	S 15.00 E	62.00	1760.95	1.25	4.67 S	2.91 W	5.50at S	31.92 W						1.92
1823.00	1.00	S 20.00 E	62.00	1822.94	2.20	5.70 S	2.58 W	6.26at S	24.37 W						.14
1884.00	1.25	S 03.00 E	61.00	1883.93	3.20	6.87 S	2.35 W	7.26at S	18.85 W						.68
1946.00	0.00	N 00.00 E	62.00	1945.92	3.70	7.55 S	2.31 W	7.89at S	17.02 W						2.02
2008.00	.75	S 62.00 E	62.00	2007.92	4.09	7.74 S	1.95 W	7.99at S	14.16 W						1.21
2070.00	.25	S 68.00 E	62.00	2069.92	4.60	7.97 S	1.46 W	8.10at S	10.40 W						.81
2131.00	.50	N 86.00 E	61.00	2130.92	4.92	8.03 S	1.07 W	8.10at S	07.59 W						.49
2193.00	1.25	S 66.00 E	62.00	2192.91	5.69	8.19 S	.15 W	8.19at S	01.03 W						1.36
2255.00	1.25	S 67.00 E	62.00	2254.89	6.94	8.73 S	1.02 E	8.80at S	07.13 E						.04
2317.00	1.00	N 90.00 E	62.00	2316.80	7.95	8.97 S	2.28 E	9.25at S	14.24 E						.82
2379.00	1.50	S 86.00 E	62.00	2378.87	8.94	9.02 S	3.63 E	9.72at S	21.92 E						.82
2440.00	1.00	S 76.00 E	61.00	2439.85	10.02	9.23 S	4.94 E	10.47at S	28.17 E						.89
2502.00	2.00	S 85.00 E	62.00	2501.83	11.34	9.49 S	6.54 E	11.53at S	34.56 E						1.65
2564.00	1.50	S 68.00 E	62.00	2563.80	12.95	9.93 S	8.37 E	12.99at S	40.13 E						1.15
2626.00	2.25	S 77.00 E	62.00	2625.77	14.74	10.54 S	10.31 E	14.74at S	44.35 E						1.30
2687.00	2.00	S 83.00 E	61.00	2686.73	16.60	10.94 S	12.53 E	16.63at S	48.89 E						.55
2749.00	2.00	S 62.00 E	62.00	2748.69	18.50	11.58 S	14.59 E	18.63at S	51.54 E						1.18
2811.00	2.00	N 87.00 E	62.00	2810.65	20.31	12.04 S	16.67 E	20.57at S	54.15 E						1.72
2873.00	2.00	S 88.00 E	62.00	2872.61	21.82	12.03 S	18.84 E	22.35at S	57.44 E						.28
2934.00	2.00	N 88.00 E	61.00	2933.58	23.33	12.03 S	20.96 E	24.17at S	60.15 E						.23
2996.00	2.00	S 82.00 E	62.00	2995.54	24.93	12.14 S	23.12 E	26.12at S	62.30 E						.56
3058.00	1.50	S 50.00 E	62.00	3057.51	26.64	12.78 S	24.89 E	27.98at S	62.81 E						1.41

AMOCO PRODUCTION COMPANY


WELL # :
 SHU NO. 157
 LOCATION :
 LEA COUNTY, NEW MEXICO
 DATE :
 11/22/89, 11/28/89, (EW) 11/30/89
 JOB TYPE :
 MMS, MMS, (EW) MMS
 JOB # :
 MS-1928, MS-1935, (EW) S0187
 SURVEYOR :
 A. HARBERT, R. RICE, (EW) G. DESPAIN
 DEPTHS :
 0'-1484', 1484'-3621', 3621'-4250'
 DECL. :
 10 DEGREES EAST
 ELEV. :
 0'
 FILE # :
 WT-F8S

SIGNAL STATION DATA:

MD. 4250.00
 TVD. 4249.16
 N/S -23.76
 E/W 50.20

CLOSURE DISTANCE
 55.54 FEET
 CLOSURE DIRECTION
 S 64.66° E

1 IN. = 10 FT.

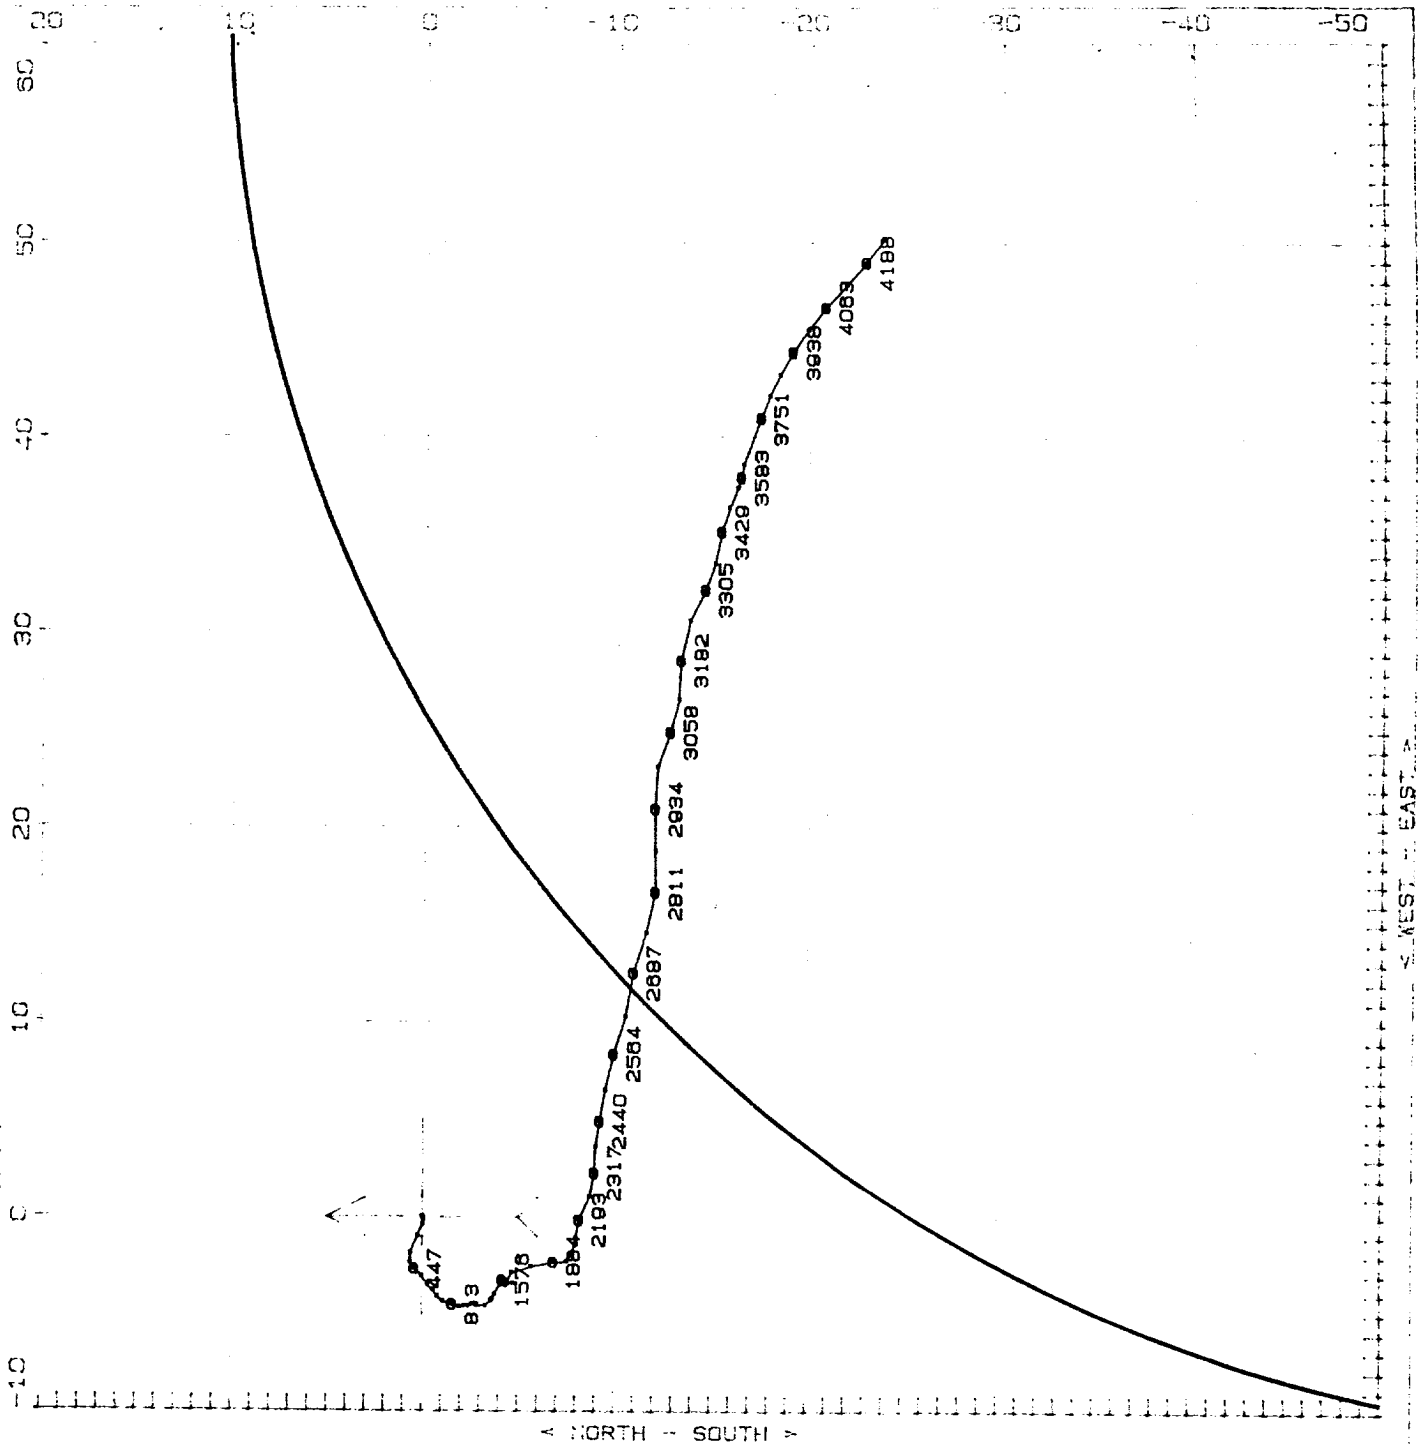



SURVEY CERTIFICATION

STATE TEXAS

COUNTY OF MIDLAND

I, D. A. HARBERT, in the employ of D.I.G., Inc., did on the days of 11-22, 1983 through 11-22, 1983 conduct or supervise the taking of a MAGNETIC MULTISHOT survey by the method of magnetic orientation from a depth of 0 feet to 1484 feet, with recordings of inclination being obtained at approximately intervals of 61 feet.

This survey was conducted at the request of AMOCO PRODUCTION COMPANY for their SHU #157, LEA County, State of NEW MEXICO in the SOUTH HOBBS field.

The data for this survey were obtained by me according to standards and procedures as set forth by D.I.G., Inc., and is true and correct to the best of my knowledge.

A handwritten signature in cursive script, appearing to read "D. A. Harbert", is written over a horizontal line.

D. A. HARBERT

The data for this survey has been examined by me and conforms to the principles and procedures as set forth by D.I.G., Inc.

A handwritten signature in cursive script, appearing to read "Larry Massey", is written over a horizontal line.


LARRY MASSEY

SURVEY CERTIFICATIONSTATE TEXASCOUNTY OF MIDLAND

I, RALPH RICE, in the employ of D.I.G., Inc., did on the days of 11-26, 1983 through 11-26, 1983 conduct or supervise the taking of a MAGNETIC MULTISHOT survey by the method of magnetic orientation from a depth of 1484 feet to 3621 feet, with recordings of inclination being obtained at approximately intervals of 62 feet.


This survey was conducted at the request of AMOCO PRODUCTION COMPANY for their SHU #157, LEA County, State of NEW MEXICO in the SOUTH HOBBS field.

The data for this survey were obtained by me according to standards and procedures as set forth by D.I.G., Inc., and is true and correct to the best of my knowledge.

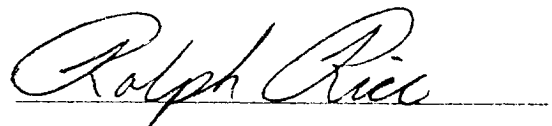

RALPH RICE

The data for this survey has been examined by me and conforms to the principles and procedures as set forth by D.I.G., Inc.



LARRY MASSEY



P. O. Box 5577/Midland, Texas 79704/(915) 583-0511

SURVEY CERTIFICATION SHEET

STATE OF TEXAS
COUNTY OF MIDLAND

I, Gary DeSpain, in the employ of Eastman Whipstock, Inc., did on the days of November 29, 1983 thru November 30, 1983 conduct or supervise the taking of a Magnetic Multi Shot survey by the method of magnetic orientation from a depth of 3621 feet to 4250 feet, with recordings of inclination and direction being obtained at approximate intervals of 62 feet.

This survey was conducted at the request of Amoco Production Company for their South Hobbs Unit Well # 157, Lea County, State of New Mexico, in the field.

This data for this survey and the calculation were obtained and performed by me according to standards and procedures as set forth by Eastman Whipstock, Inc. and is true and correct to the best of my knowledge.

Gary DeSpain
Directional Supervisor/ Surveyor

The data for this survey has been examined by me and conforms to principles and procedures set forth by Eastman Whipstock, Inc.

Tim Stephens

Before me, the undersigned authority, on this day personally appeared Gary DeSpain, known to me to be the person whose name is subscribed to this instrument, who after being by me duly sworn on oath, states that he has knowledge of all the facts stated above and that this instrument is a true statement of facts therein recited.

Subscribed and sworn to before me on this 30TH day of Nov., 1983

Roy C. Stinkle
Notary Public in and for the
County of Midland, Texas
My commission expires 7/9/85

