

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30 025 32624
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	WILLIAM WEIR
8. Well No.	6
9. Pool Name or Wildcat	MONUMENT ABO
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3687'

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>N</u> : <u>425</u> Feet From The <u>SOUTH</u> Line and <u>1830</u> Feet From The <u>WEST</u> Line Section <u>23</u> Township <u>19-S</u> Range <u>36-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3687'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐ SQUEEZE TOP LATERAL ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-06-01: MIRU. NDWH. NUBOP. REL TAC.
2-07-01: TIH W/BIT, 2 7/8" TBG, CSG SCRAPER ON WS. STOP BIT @ 4814'.
2-08-01: TAG @ 7390'. SCRAPER @ 7358'. TIH W/RBP & PKR. TAG @ 7239'. UNABLE TO WORK PAST TOP WINDOW. TIH W/RBP & PKR. STOP PKR @ 1751'.
2-09-01: SET RBP @ 7280. TEST TO 700#-OK. PULL TO 7236'. SPOT 31' SAND ON TOP OF RBP. TIH W/CMT RET ON TBG. SET PKR @ 7102'. PUMP 41 BBLS THRU RET. TEST TBG TO 2500#-OK. LOAD & TEST BACKSIDE TO 500#-OKI. ATTEMPT TO SQUEEZE UPPER ABO LATERAL 7228-8073'. MIX & PUMP 100 SX CL H W/3% D-167 + 2% D-65. TAIL IN W/100 SX CL H NEAT. DISPL & CLEAR RET. REV OUT 10 BW.
2-12-01: TAG ON VAC. TEST BACKSIDE TO 500#. RE-SQUEEZE UPPER ABO LATERAL 6228-8305' W/200 SX 12-2 RFC W/12% D-053 + .2% GYPSUM. TAIL IN W/200 SX CL H CMT W/3% D-167 + .2% D-65. STING OUT OF RET & PULL TO 6484 & REV OUT 28 SX TO PIT @ 2000#. DUMP 67 SX ON TO9P OF RET. BTM NOF RET TO TOP OF WINDOW 14 SX IN CSG. PUMP 291 SX INTO LATERAL. DID NOT PUMP 400 SX CL H NEAT. WOC.
2-13-01: TIH W/BIT. PU DC'S ON TBG. TAG CMT @ 6447'. DRILL OUT 6447-6850.
2-14-01: DRILL OUTN 6850-7102. DRILL OUT CMT RET 7102-7103.
2-15-01: TIH W/BIT, STABILIZER, DC'S TO 7103. DRILL HARD CMT TO 7143'.
2-16-01: DRILL OUT HARD CMT 7143-7260. TEST TO 500#. ON CHART FOR 30 MINS. LOST 70# IN 30 MINS. (Test 392-NO CHART REG'D)
2-19-01: TIH W/RET TOOL, SN ON WS. STOP @ 7260'. RU SWAB. FL @ 500'. END FL @ 2000'.
2-20-01: REPAIR SAND LINE. FL @ 3000'. END FL @ 6500'.
2-21-01: LOAD CSG W/2% KCL WTR & BREAK CIRC. SAND OFF RBP TO 7280. LATCH & REL RBP. PREDSS CSG TO 500#. NO LEAK OFF. LOWER LATERAL & ABO CSG PERFS SQUEEZED OFF. TIH W/BIT, DC'S, STABILIZER, ON TBG. TAG CMT @ 7318'. LOWER WINDOW 7307-14. ABO PERFS 7419-7540. PULL BIT TO 7050'.
2-22-01: LOWER BIT TO 7318'. DRILL CMT 7318-45. DRLG FORMATION 7345-60.
2-27-01: TIH W/CIBP & SET @ 7160'. TIH W/CMT BAILER & DUMP 35' CMT ON CIBP. TA ABO. PBTD-7145'. TIH W/TBG OPEN ENDED TO 7100. TEST PLUG & CHART FOR NMOCD FOR 30 MINS-OK. TIH W/PROD TBG. NDBOP. NUWH. RIG DOWN 3-02-01. WELL IS TEMPORARILY ABANDONED. SI


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 4/2/01
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY: _____ TITLE _____ DATE _____

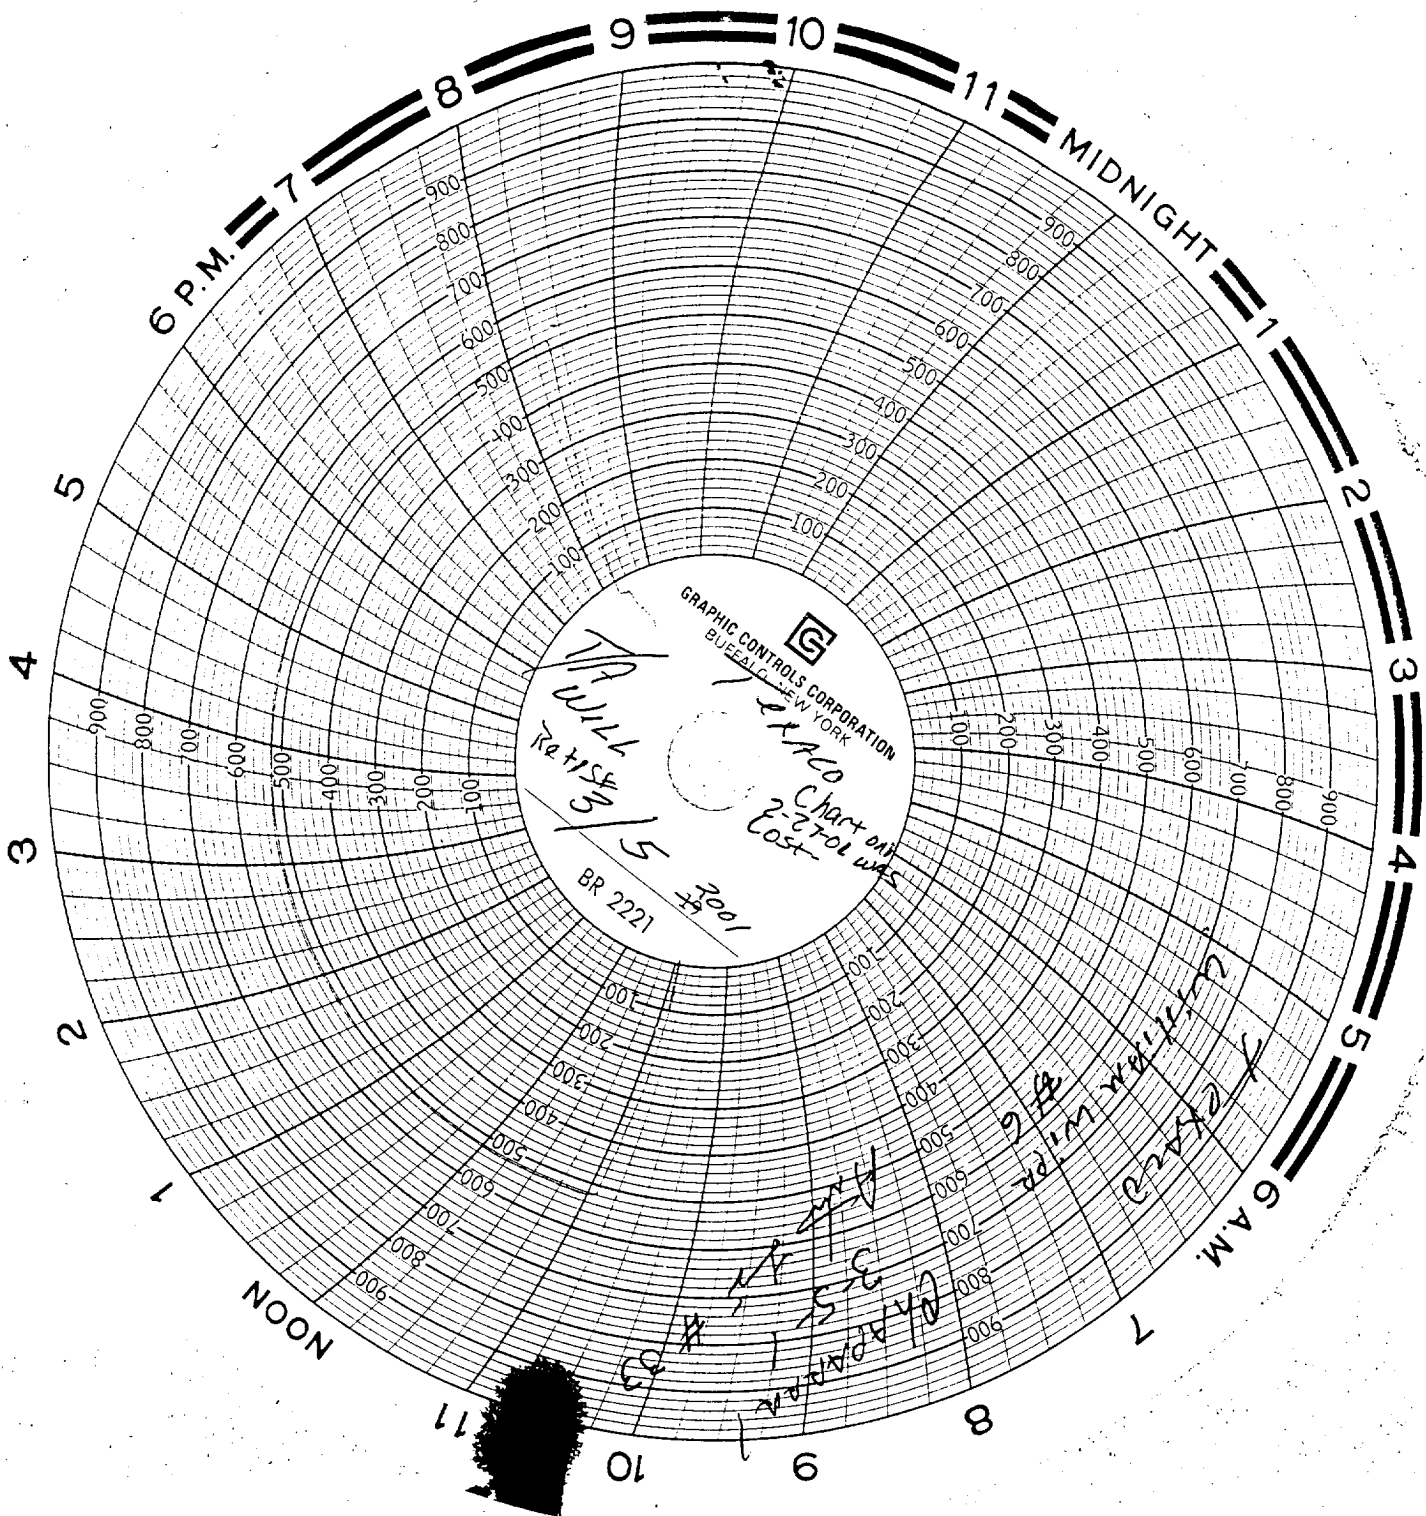

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

TPA Will
Re-tighten
5/5 3001

BR 2221

Chart only
2-27-01 was
lost

CHAPMAN WIPR
#16

CHAPMAN
#35
#1

