


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Las Cruces

Lease No. 032094 (u)

Unit N.M.P.U.

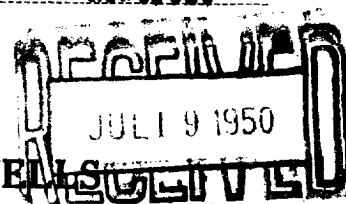

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

A. W. Lockhart 27 No. 2-E State, New Mexico July 17, 19 50

Well No. 2-E is located 2000 ft. from N line and 300 ft. from W line of sec. 27

27 27 27 27
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
San Juan Las New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3622 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Set 5 1/2" casing at 700' and cemented with 500 sacks cement. Total depth of hole 700' to ground. Plug down 2000 P.M. 7-13-50. Top of cement tested casing 200' by temperature survey.

On 7-13-50 after 48 hours HSE tested casing with 1200' for 30 minutes. Final pressure 1275'. Top of cement plug 700'. Drilled plug and tested casing with 1200' for 30 minutes. Final pressure 1250'.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Continental Oil Company

Address San Juan

State, New Mexico

By E. L. Leland

Title District Superintendent