

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103
(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

Name of Company Gulf Oil Corporation		Address Box 2167, Hobbs, New Mexico				
Lease Burice King	Well No. 26	Unit Letter H	Section 28	Township 21-S	Range 37-E	
Date Work Performed Oct. 18-Nov. 1, 1960	Pool Penrose Skelly			County Lea		

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations ☐ Casing Test and Cement Job ☒ Other (Explain):
☐ Plugging ☐ Remedial Work **FB & Recompleted**

Detailed account of work done, nature and quantity of materials used, and results obtained.

Abandoned Hare Pool, recompleted in Penrose Skelly Pool as follows:

1. Set 7" GI BP on electric line @ 7300'. Dumped 2 sacks cement on top of BP. Loaded hole with drilling mud. Pressure tested 7" casing with 1000# for 30 minutes. No drop.
2. Set GI BP on electric line @ 3950'. Dumped 2 sx cnt on BP. Calculated PBD 3942'.
3. Ran 2-3/8" tbg w/Dowell's Abrasijet tool. Ran GR tie-in log. Perforated 7" csg @ 3725', 3707', 3689', & 3644'.
4. Ran 2-7/8" tbg w/Baker FB pkr set @ 3629'. Acidized perfs 3644-3725' w/500 gals 15% NE acid. Treated same perfs w/20,000 gals refined oil with 1/40# Adomite M-II & 3# SPG in five equal stages. TP 4900-5500#. IR 9.8 BPM.
5. Snubbed and tested. Recovered all load.

Witnessed by G. W. Osborn	Position Production Foreman	Company Gulf Oil Corporation
-------------------------------------	---------------------------------------	--

FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

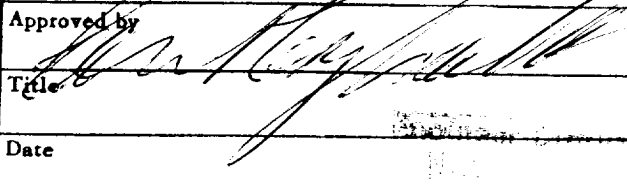
D F Elev. 3440'	T D 7650'	P B T D 7603'	Producing Interval 7405-7600'	Completion Date 1-18-51
Tubing Diameter 2-3/8"	Tubing Depth 7535'	Oil String Diameter 7"	Oil String Depth 7649'	
Perforated Interval(s) 7405-7600'				
Open Hole Interval			Producing Formation(s) McKee	

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover	Hare Pool 4-9-60	5	227	0	45,400	---
After Workover	Penrose Skelly 10-29-60	119	257	0	2,160	---

OIL CONSERVATION COMMISSION

I hereby certify that the information given above is true and complete to the best of my knowledge.

Approved by 	Name John Russell
Title Area Production Manager	Position Area Production Manager
Date 11-1-60	Company Gulf Oil Corporation