


(SUBMIT IN TRIPLICATE)

Land Office New Mexico

Lease No. W-011690

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

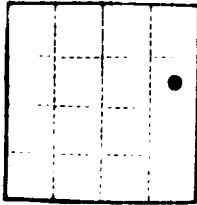

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NO	SUBSEQUENT REPORT OF INJECTING OR ACIDIZING
NO	SUBSEQUENT REPORT OF ALTERING CASING
NO	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NO	SUBSEQUENT REPORT OF ABANDONMENT
	SUPPLEMENTARY WELL HISTORY

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 2, 1962

San Simon Unit

Well No. 1 is located 1980 ft. from N line and 660 ft. from E line of sec. 26

NE 1/4, sec. 26,
(1/4 Sec. and Sec. No.)

21-S
(Twp.)

32-E
(Range)

NMPM
(Meridian)

Undesignated
(Field)

Lee
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 3785 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

TD 9000'. Completed dry. Plugged and abandoned as follows: Spotted cement plug 9000 to 8800', using 60 sacks regular neat cement. WOC 5 hours. Found top of plug #1 at 8754'. Set 100 sack cement plug # 2 from 3700 to 3600'. WOC 6 hours. Found top of plug at 3670'. Set 95 sacks cement plug # 3 from 3644 to 3350'. WOC 6 hours. Found top of plug at 3372'. Set 25 sack cement plug from 50' to surface. Installed 4" x 4' steel marker. Plugged and abandoned 8: AM, 3-2-62.

Verbal approval for this work was obtained from Mr. J. B. Ealey prior to work.

MAR 6 1962

STANDLEY

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Gulf Oil Corporation

Address Box 2167, Hobbs,

New Mexico

By John Russell

Title Area Production Manager