


Form 9-831a  
(Feb. 1951)

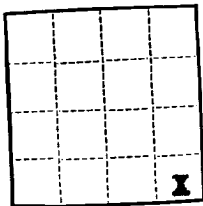

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Las Cruces  
Lease No. 032099 (a)  
Unit P

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			
<u>Cement Casing</u>	<u>XX</u>		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 5, 19 62

Lockhart A-18  
Well No. 1 is located 330 ft. from (N) line and 330 ft. from (E) line of sec. 18  
SE/4 Sec. 18 21S 36E NMPM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Eurice Lea New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3633 ft. KB

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On February 23, 1962, a gas flow around the surface casing was noted and the well was shut in.

It is proposed to set BP at 3030', perforate casing at 3000', set retainer at 2960' and pump in 400 sacks cement, drill out cement and test for gas shut-off.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Continental Oil Company

Address Box 68,

Eurice, New Mexico

0/2 USGS; NMOCC-2; WAN; File

Pan Am-Hbs-2; Atl-Rosw-2; Std-Houst, Mid. 1 ea.

By John W. Wolf for  
Title District Superintendent