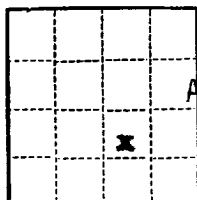


APPROVED

Form 9-381a
(Feb. 1961)

JUL 1 1963

(SUBMIT IN TRIPLICATE)

Budget Bureau No. 42-R358.4.
Form Approved.Land Office Las CrucesLease No. 0317402(a)J. L. GORDON
ACTING DISTRICT ENGINEER
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

JUN 4 1963

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	X
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

May 31

19 63

Meyer A-1
Well No. 14 is located 1980 ft. from [N] line and 1980 ft. from [E] line of sec. 18
NW/4 SE/4 Sec. 18 21-S 36-E NMPH
($\frac{1}{4}$ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
NMPH Lee New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3635 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

TD 3919', DP 10', ELEV 3635' DP. CSG PT 5-1/2" AT 3777 - 4" LINER SET FROM 3745' TO 3919'. PAY SAN ANDRES 3882-3918'. PERFS 3882-94', 3902-12', 3914-18'. WELL WAS SHUT-IN INCAPABLE OF COMMERCIAL PRODUCTION. PLUGGING WAS ACCOMPLISHED IN THE FOL MANNER: SET A 20 SACK CEMENT PLUG FROM 3780' TO 3620'. SET A 10 SACK CEMENT PLUG AT SURFACE. FILLED INTERVALS BETWEEN CEMENT PLUGS WITH 10 LB. MUD. ERECTED 4" MARKER EXTENDING 4' ABOVE SURFACE WITH WELL NAME AND LOCATION INSCRIBED THEREON. LOCATION RESTORED TO ORIGINAL CONDITION. PLUGGING STARTED 5-24-63, COMP 5-25-63. ALL CASING WAS LEFT IN THE HOLE.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Continental Oil CompanyAddress Box 68Elmico, New Mexico

By _____

USGS-5 NMOC-3 AHS FILE
PAN AM-HBS-3 ATL-HOS-2
CALIF OIL-HOUS, MID - 1 EachTitle District Superintendent