


Form 9-331a
(Feb. 1951)

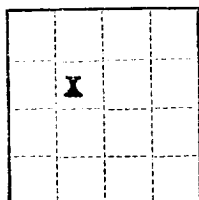

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Las Cruces
Lease No. 031741 (b)
Unit NMFU

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		
Subsequent Report of Perf. Additional Zones		<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Hawk B-10

February 17, 1959

Well No. 3 is located 2310 ft. from N line and 2310 ft. from W line of sec. 10

NW/4 Sec. 10 21-3 37-1 NMFU
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Hare Lea New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3463 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

TSD oil well prior to workover.

WORK DONE - Perf'd. Lower McKee 7923-35', 7948-56', 7967-74' and 7982-96' w/4 JSPF. Sandfraced 7923-8068' w/5,600 Gals. Std. treatment. Perfs. 7923-8068' swabbed dry. Sandfraced McKee formation 7656-7716', 7726-84', 7794-7828', 7850-94' w/18,000 Gals. Std. treatment w/500 Lbs. rock salt. Recovered load oil.

AFTER WORKOVER - TD 8075' sand, DOD 8070'. Pay McKee 7656-7894'. Perfs. 7656-7716', 7726-84', 7794-7828', 7850-94'. IP gas lifted 37 BO, 26 BW, in 24 Hrs., thru 3/4" Positive Chk. TP 125 Lbs. CP 550 Lbs., w/53 MCFGPD. GOR 1432. DOR 37 Bbls. Daily Allow. 37 BO. Workover started 1-13-59, completed 2-3-59. Well tested 2-14-59.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Continental Oil Company

Address Box 68

Elmice, New Mexico

By _____

Title District Superintendent