


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Las Cruces**

HOBBS OFFICE **031741 b**
Lease No. **Nov 12 8 10 AM '63**
Lot x or 24

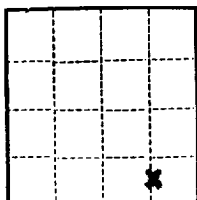

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	Subsequent Report to Plugback & Test

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 6, 1963

Hawk B-3
Well No. **6** is located **310** ft. from **XN** line and **660** ft. from **E** line of sec. **3**
SE/4 or Lot 24 Sec.3 21-S 37-E NMPM
NMPM (Field) **Lea** (County or Subdivision) **New Mexico** (State or Territory)

The elevation of the derrick floor above sea level is **3464** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

BEFORE WORKOVER: TD 7825' LM, PB 7495', DF 11', ELEV 3464' DF. PAY GLORIETA 5280-5344'. DSG PT 5 1/2" AT 7805'. PERFS 5280-82', 5300-02', 5304-13', 5317-20', 5339-44'. WELL SHUT IN PRIOR TO WORKOVER. **WORK DONE:** SET CIBP AT 4200' W/10' CMT ON TOP. PERF SAN ANDRES 3958-68', 3982-88', 4000-06', 4009-12', 4035-42', 4048-54', & 4062-69' W/2 JSPP. TRTD PERFS W/5000 GAL 15% LSTNE ACID IN 4 STAGES USING 60 BALL SEALERS. **AFTER WORK-OVER:** TD 7825' LM, PB 4190', DF 11', ELEV 3464' DF, PAY SAN ANDRES 3958-4069'. NEP 0'. CSG PT 5 1/2" AT 7805'. PERFS - SAME AS ABOVE (3958-4069'). AFTER TREATMENT, ONLY 3 BOPD PRODUCTION WAS REALIZED. **WORKOVER UNSUCCESSFUL SINCE PRODUCTION IN COMMERCIAL QUANTITIES WAS NOT OBTAINED. WORKOVER STARTED 10-14-63, COMP 10-15-63, WELL TSD 11-6-63.**

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Continental Oil Company**

Address **Box 68 - Eunice, New Mexico**

USGS O/4 NMOCC-2 ABS FILE
PAN AM-HBS-3 ATL-ROSW-2
CALIF OIL-HOUS, MID - 1 Each

By **[Signature]**
Title **District Superintendent**