

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

LC - C 32571C

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

**SUBMIT IN TRIPLICATE**

1. Type of Well:

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

CAMPBELL & HEDRICK

3. Address and Telephone No.

P. O. BOX 401, MIDLAND, TEXAS 79702 915-684-4393

4. Location of Well (Footage, Sec., T., R., M., or Survey Description):

330 FSL & 1650 FEL S19-T21S-R37E

8. Well Name and No.

HARDY #5

9. API Well No.

30-025-06677

10. Field and Pool, or Exploratory Area

PADDOCK AND BLINEBRY

11. County or Parish, State

LEE, New Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent  
☒ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other
- ☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion or Well Completion or Recompletion Report and Log form.)


13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Blinebry zone died--swab water.

Pull Paddock rods and tubing unlatch from permanent packer and pull Blinebry string. Find collar leak and hole. REplace with new joint and new collar. Run Blinebry tubing. Latch into packer. Found tail pipe plugged. Perforate 2 3/8 tail pipe below packer at 5580--5581 with 4 1/4" dia holes.

Run Paddock tubing Latch into parallel anchor. Run rods. Work complete August 4, 1999.

Preparing to run packer leakage test.

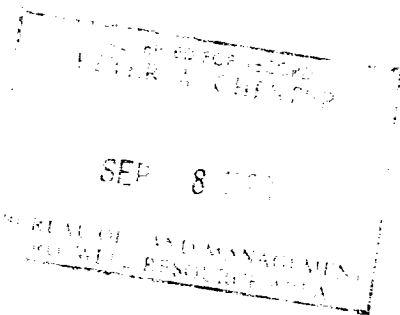

14. I hereby certify that the foregoing is true and correct

Signed

*C. H. Harris*

Title

OPERATOR

Date

8/4/99

(This space for Federal or State office use)

Approved by

Conditions of approval, if any

Title

Date

REC-111

ALB 100

RC SW 111 NM

