

0+5-MMS-Roswell, 1-File, 1-Engr. RH, 1-Foreman-CRM, 1-BW, 1-Laura Richardson-Midland, 8-WIO'

Form 9-331
Dec. 1973

Form Approved.
Budget Bureau No. 42-R1424

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well

2. NAME OF OPERATOR

Getty Oil Company

3. ADDRESS OF OPERATOR

P.O. Box 730, Hobbs, NM 88240

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: Unit Ltr. K, 1980' FSL & 1980' FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:


16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐

SUBSEQUENT REPORT OF:

☒
☐
☐
☐
☐
☐
☐
☐
☐
☐

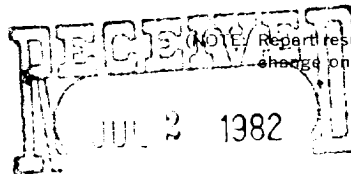

5. LEASE

14331

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Bilbrey 29 Fed Com

9. WELL NO.

1

10. FIELD OR WILDCAT NAME

Bilbrey Basin Morrow

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 29, T-21S, R-32E

12. COUNTY OR PARISH

Lea

13. STATE

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

3582.4 GR

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is already drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6/24/82 TIH 6 1/8" hole @ 14720'. Ran 55 jts 2161.23' of 4 1/2", 8R, S-95, 13.50#, R-3 csg. Float shoe @ 14720', Float collar @ 14678', Landing collar @ 14677' and Otis liner hanger w/ packoff @ 12555' to 12533'. Top of liner @ 12,533'. By Howco cement w/ 100 sxs 75/25 poz mix containing 2% gel, 3/4% CFR-2, 4/10% HR-5 and 4/10% H-22A. Tailed in w/ 385 sxs Class "H" w/ 6/10% H-22A, 5/10% CFR-2, 3# KCL, 5/10% HR-5 w/ gas check. Displaced w/ 35 bbls Sam 5 and 84 bbls mud. Bump plug @ 2500# @ 11:20 PM. Total cement 485 sxs.

6/25/82 WOC 18 hours pressured up on csg. to 1500# for 30 min. ok.

Subsurface Safety Valve: Manu. and Type

Set @ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED

David R. Creekett
D. R. Creekett

TITLE Area Superintendent

DATE June 30, 1982

ACCEPTED FOR RECORD

(ORIG. SCD.) DAVID R. CREEKETT

APPROVED BY
CONDITIONS OF

APPROVAL, IF ANY:

OCT 20 1982

DATE

RH

U.S. GEOLOGICAL SURVEY

ROSWELL, NEW MEXICO *See Instructions on Reverse Side