


Form 9-331a
(Feb. 1951)

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Las Cruces
Lease No. LD 030557
Unit 10 PD

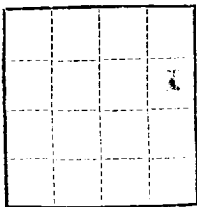

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Subsequent rpt of Plugback and Recomplete</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Farney -5

June 3, 1957

Well No. 2 is located 1980 ft. from [N] line and 660 ft. from [E] line of sec. 5

Rm 4 Sec 5 23 S 36 E 107 W
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Jalant Lea New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

Before workover: TO sand 3795', FB 3617', 10' 10', elev 3486'.
Pay Yates 3300-3585'. Casing point 5 1/2" set at 3647'. Perf 3300-3520', 3530-50', 3555-85'. T.B.
Work one: Set squeeze tool at 3239', squeezed perfs 3300-3585' w/350 sacks cement. Drilled cement plug to 3470'. Perforated 3327-45', 3304-3408', 3438-64' w/2 shots per ft. Treated new perfs w/600 gals acid and acid, sandfraced w/10,000 gals crude w/1 sand and 0.1 sodaite per gal. Swabbed dry, failed to recover load oil. Casing and log under vacuum. Shut in.
After workover: TO sand 3796', FB 3470'. Pay Yates 3327-3464'. Casing point 5 1/2" set at 3647'. Perf 3327-45', 3304-3408', 3438-64'. T.B. Workover started 4-26-57, completed 5-20-57, tested 5-20-57.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Continental Oil Company

Address Box 68

Alamogordo, New Mexico

By _____

Title District Superintendent