




WELL DATA SHEET

LEASE LEE STEBBINS (NCT-A) WELL NO. 2 FIELD PENROSE SKELLY DATE 11/89
LOCATION 1980 FEET FROM N LINE AND 660 FEET FROM W LINE
SECTION 5 BLOCK T22S SURVEY R37E COUNTY LEA STATE NM

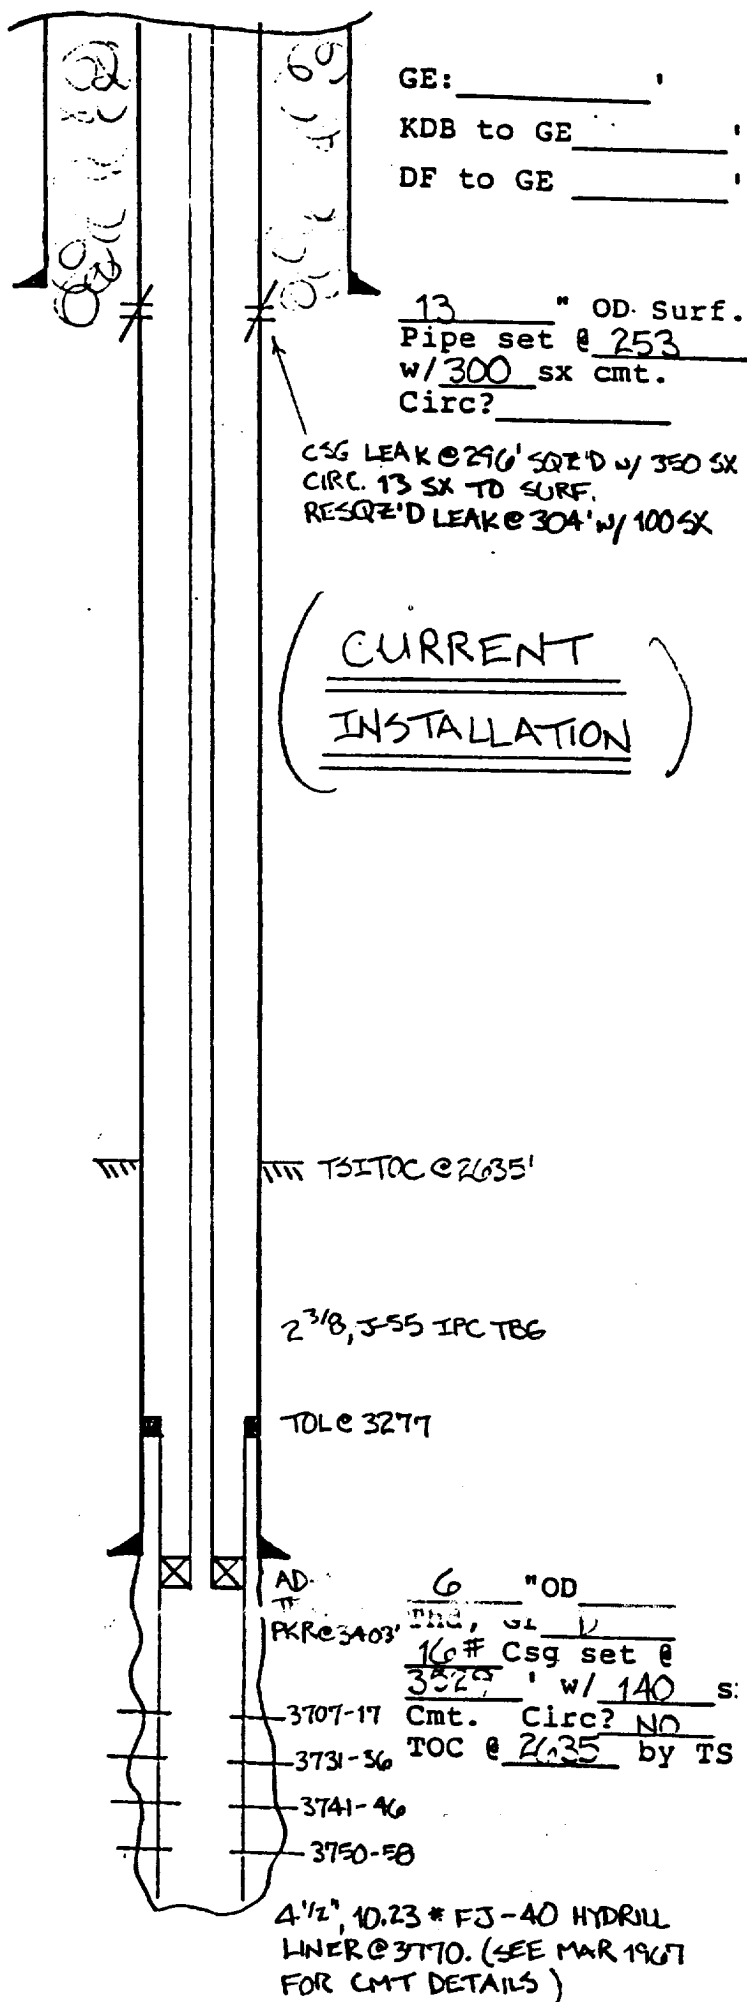

Date Completed JAN 1938
Initial Formation GRAYBURG
FROM: _____ TO _____ GOR _____
Initial: Production _____ bopd _____ bwp _____
Or: Injection _____ bwpd at _____ ps
Completion Data:
ACIDIZED OH SECTION 3529-3770 w/ 2000 GALS
15% HCL. IPE 110 BOPD, 8 BWPD & 502 MCFGPD.

(DEC 1938) ACIDIZE OH SECTION 3529-3770 w/
5000 GALS 15% HCL. IPE 50 BOPD, 2 BWPD & 248
MCFGPD. BA - FIG 43 BOPD, 2 BWPD & 100 MCFGPD.

Subsequent Workover or Reconditioning:
(? 1942) INSTALLED BEAM PPG EQUIP. IPE 6 BOPD &
1 BWPD. BA - FLOWED INTERMITTENTLY.

(FEB 1946) INSTALLED GAS LIFT EQUIP. PRODUCING
15 BOPD & 1 BWPD. BA - PPG 5 BOPD.

(JULY 1958) SET LINES ON PKR @ 3680. FRAC'D OH w/
20,000 GALS 15% OIL & 20,000 #SD @ 20.7 BPM IN 2 STAGES
INSTALLED PPG EQUIP. IPE 12 BOPD, 50 BWPD & 50 MCFGPD.

(MAR 1963) WELL DOWN. UNECONOMICAL TO PULL @ 3 BOPL

(MAR 1967) INSTALL LINER & CONVERT TO W.W. SQZ'D
CSG LEAK @ 296' w/ 350 SX. CIRC. 13 SX OUT OF 13\"
RAN 4 1/2\", 10.23# LINER TO 3773 w/ TOL @ 3277. CMT'D w/
100 SX. PLUG DID NOT SEAT. CIRC. OUT ALL CMT. ATTEMPT
TO PULL LINER - UNSUCCESSFUL. SET CIRC. INSIDE LINER
@ 3756. PUMPED 150 SX CMT. LOST RETURNS AFTER 45S
REACHED BOTTOM. DO TO 3769. SET CIRC @ 3701 (PUMPE
THROUGH PRIOR TO SETTING). ATTEMPTED TO PUMP INTO
BOTTOM OF LINER. HELD 3200 PSI FOR 5 MINUTES. TESTE
TOL TO 3200 PSI. LOST 1000 PSI IN 5 MINUTES. LOCATED
LEAK ABOVE PKR @ 304'. SQZ'D w/ 100 SX. DO & TESTED
TO 300 PSI - OK. DO CIRC @ 3701 & CO TO 3770. SD
WAITING ON INJ EQUIP.

(MAY 1967) PERF'D 4 1/2\"
3731-36 & 3707-17 w/ 2 JHFF. ACIDIZE w/ 500 GALS
15% HCL. RAN AD-1 TENSION PKR ON 2 3/8 J-55 IPC
TBG. SET PKR @ 3403. CI WAITING ON INJ LINE.

(JUN 1967) STARTED INJ. WELL NAME SPSU 111 WIC.

(JAN 1968) POLYMER SQZ FOR INJ PROFILE. PUMPED
10 BBIS HOWCO INJECTROL INTO PERFS 3707-17. PRES
TESTED PERFS 3707-17 TO 1000 PSI. LOST 250 PSI IN 5
MINUTES. DETERMINED THAT PERFS 3707-17 & 3731-36
WERE IN COMMUNICATION. UNABLE TO PUMP INTO ENTIRE
PERF'D INTERVAL. ACIDIZE 3707-58 w/ 1500 GALS 20% HCL
TO REESTABLISH INJ. PUMPED INTO PERFS @ 1.5
BPM & 1000 PSI. PLACED BACK ON INJ.

(1984) S. PENROSE SKELLY UNIT DISBANDED.