

NUMBER OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
TRANSPORTER	OIL
	GAS
PRODUCTION OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103
(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule H06)

Name of Company HUMBLE OIL & REFINING COMPANY				Address Box 2347, Hobbs, New Mexico			
Lease New Mexico State M		Well No. 22	Unit Letter B	Section 29	Towship 22-S	Range 37-E	
Date Work Performed 6-19-61, 7-17-61		Pool Langlie Mattix			County Lea		

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations
 ☐ Casing Test and Cement Job
 ☐ Other (Explain):
- ☐ Plugging
 ☒ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

Pulled tubing and rods. Perforated 2-7/8" csg from 3559-3564 w/2 shots per ft. Set bridge plug at 3570'. Frac perforations from 3559-3564 w/10,000 gal Humble Frac and 20,000# sand. Average injection rate 5.2 BPM. Retrieved bridge plug. Placed well on pump.

Witnessed by S. B. Carlson	Position Field Supt.	Company HUMBLE OIL & REFINING COMPANY
--------------------------------------	--------------------------------	---

FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

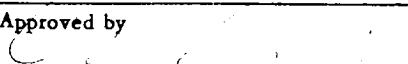
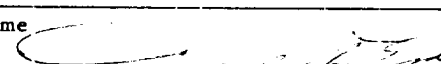
D F Elev. 3364	T D 3678	P BTD 3635	Producing Interval 3576-3586 3600-3605	Completion Date 9-28-60
Tubing Diameter 1-1/2	Tubing Depth 3588	Oil String Diameter 2-7/8	Oil String Depth 3678	
Perforated Interval(s) 3576-3586, 3600-3605				
Open Hole Interval		Producing Formation(s) Queen		

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover	4-22-61	9	122	-	13556	
After Workover	7-17-61	13	213	-	16385	

OIL CONSERVATION COMMISSION

I hereby certify that the information given above is true and complete to the best of my knowledge.

Approved by 	Name 
Title	Position Agent
Date	Company HUMBLE OIL & REFINING COMPANY