


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

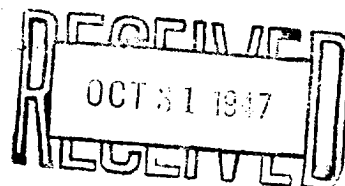

HOBBBS OFFICE

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

| | | | |
|--|----------|--|--|
| REPORT ON BEGINNING DRILLING OPERATIONS | | REPORT ON REPAIRING WELL | |
| REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL | | REPORT ON PULLING OR OTHERWISE ALTERING CASING | |
| REPORT ON RESULT OF TEST OF CASING SHUT-OFF | | REPORT ON DEEPENING WELL | |
| REPORT ON RESULT OF PLUGGING OF WELL | X | | |

October 24, 1947

Midland, Texas

Date

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO.

Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the

Humble Oil & Refining Co.E. C. MesleyWell No. 2

in the

Company or Operator

Lease

SE/4of Sec. 10T. 24-SR. 36-E

N. M. P. M.,

Cooper-Jal

Field,

Lea

County.

The dates of this work were as follows: October 19, 1947 to October 23, 1947Notice of intention to do the work was ~~(submitted)~~ submitted on Form C-102 on October 7 19 47and approval of the proposed plan was ~~(obtained)~~ obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

Pulled and re-ran tubing. Ran 50 sacks cement to bottom. Shot 5 1/2" casing at 2200' and pulled 52 joints. Ran tubing and mixed 28 sacks mud and 50 sacks cement. Spotted cement plug at 2200'. Shot 7-5/8" casing at 800', 650', 500' and 427'. Pipe came loose at 427'. Recovered 427'. Plugged well with 50 sacks from 450'-350'. Plugged well from 200' to 100' with 42 sacks cement. Plugged top of hole with 8 sacks Inner Cement. Installed regulation marker.

Witnessed by _____
Name Company Title

Subscribed and sworn before me this _____

I hereby swear or affirm that the information given above is true and correct.

29th day of October, 19 47Name [Signature]Position Division SuperintendentRepresenting Humble Oil & Refining Co.

Company or Operator

My commission expires 6-1-49Address Box 1600, Midland, Texas

Remarks:

OCT 31 1947

[Signature]
Name

Title