


WELL:
POOL:
LOCATION:

COUNTY/STATE:

Skelly Penrose -A- Unit # 57
Langlie Mattix; 7 Rvrs-Q-Grayburg Pool (37240)
1980' FSL & 1980' FEL
Unit J, Sec 9, T-23S, R-37E
Lea County, New Mexico

Current Completion

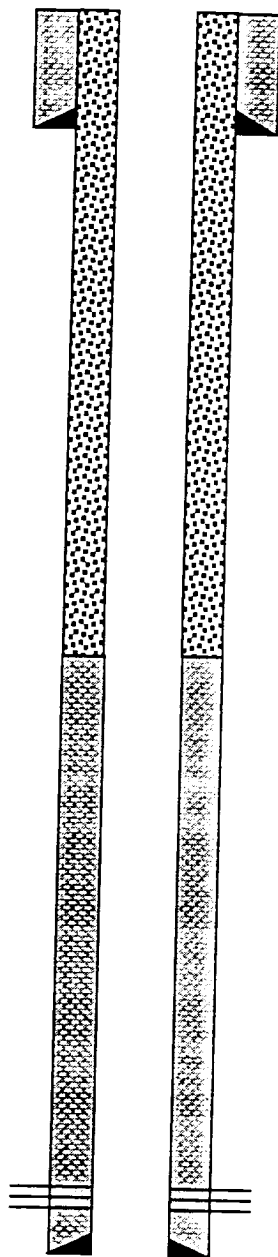

TD @ 3642'
PBTD @ 3631'

11" Hole
8-5/8" 32# H-40 CSA 372'
Cement w / 250 sx
Circulated to Surface


Cement squeeze thru
casing leaks 378-533
w/ 1000 sx - No Circulation
thru Bradenhead
Estimate TOC +/- Surface

7 Rvrs-Queen-Grayburg Perfs:
3496-3628
Cement squeezed w/ 500 sx

Perfs: 3520, 33, 44, 52, 71, 75,
98, 3606

7-7/8" Hole
5-1/2" 14# CSA 3641'
Cement w / 375 sx
TOC @ 1807' (Estimated)

P&A Proposal

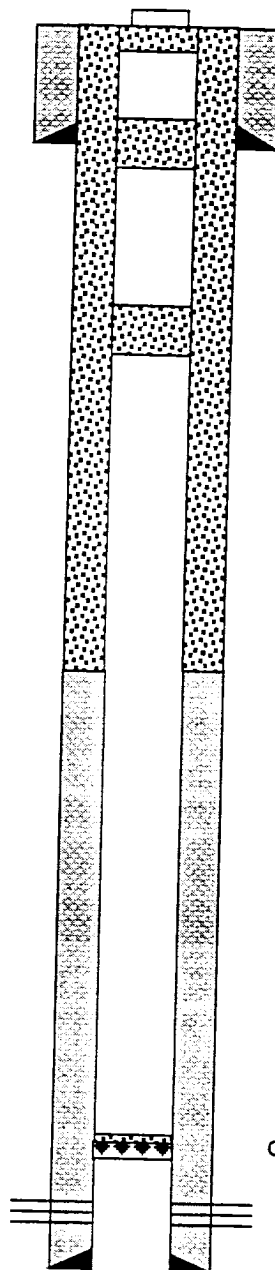

Install P&A Marker
Surface Plug - Spot 10 sx

Cement Plug 350' - 450'
w/ 25 sx

Cement Plug 1130' - 1230'
w/ 25 sx

CIBP @ 3450' w/ 10 sx

TD @ 3642'
PBTD @ 3631'