

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103

(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

Name of Company Resler and Sheldon			Address 302 Carper Bldg., Artesia, New Mexico			
Lease Steeler 1	Well No. 1	Unit Letter I	Section 20	Township 23S	Range 37E	
Date Work Performed June 1959	Pool Teague-Grayburg			County Lea		

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations ☐ Casing Test and Cement Job ☐ Other (Explain):
☐ Plugging ☒ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

See C-103 of June 3, 1959. On further testing well had excessive GOR. Pulled tubing and re-run with hook-wall packer set at 3580'. Has a side-door adjustable choke at 3550'. With a 1/64th inch opening, well flows satisfactorily. Tubing set @ 3600'.

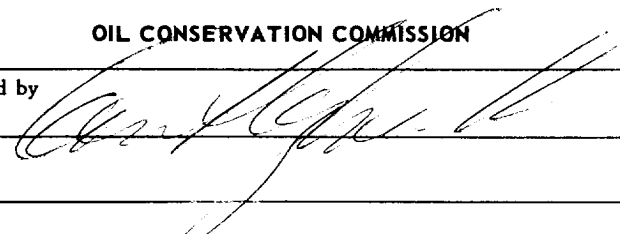
Witnessed by Jimmy Evans	Position Supt.	Company Resler and Sheldon
------------------------------------	--------------------------	--------------------------------------

FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA				
D F Elev.	T D	P B T D	Producing Interval	Completion Date
Tubing Diameter	Tubing Depth	Oil String Diameter	Oil String Depth	
Perforated Interval(s)				
Open Hole Interval		Producing Formation(s)		

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover	June 1959	2	500	5	100,000	
After Workover	July 1959	30	60	20	2,000	

OIL CONSERVATION COMMISSION		I hereby certify that the information given above is true and complete to the best of my knowledge.	
Approved by 	Name Carlos J. Resler	Position Resler and Sheldon	
Title	Company Partner		
Date			