


UNITED STATES
 DEPARTMENT OF THE INTERIOR
 GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE
 (Other instructions on reverse side)

Form approved
 Budget Bureau No. 42-111
 5. LEASE DESIGNATION AND SERIAL NO.
 LC-030187

SUNDRY NOTICES AND REPORTS

(Do not use this form for proposals to drill or to deepen or plug well on a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)

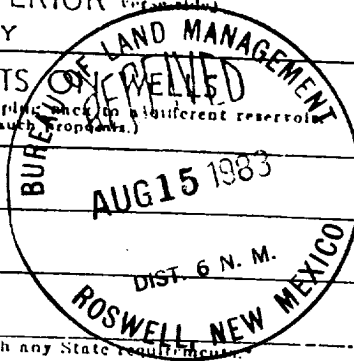

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR
 Gulf Oil Corporation

3. ADDRESS OF OPERATOR
 P. O. Box 670, Hobbs, NM 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
 At surface
 660' FSL + 1980' FEL

7. UNIT AGREEMENT NAME

8. NAME OF LEASE NAME
 LaMunyon Fed'l

9. WELL NO.
 3

10. FIELD AND TOOL, OR WILDCAT
 Langlie Mattie

11. SECTION, R. M., OR NEAR AND SURVEY OR AREA

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GA, etc.)

3259' GL

Sec 22-T23S-R37E

12. COUNTY OR PARISH 13. STATE
 Lea NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting a proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

POH up rods + thg. found leak @ 700'. Set cmt retainers @ 638', test thg 3000#. Ppd 350 sq ft "C" cmt. Dump 3 sq sand on retainers. Dril cmt + retainers. Circ hole clean. Test csq to 500#, press would bleed off to 0# in 5 min. Test thg to 500# w/ pkr, held ok. Set cmt retainer @ 640'. Press thg to 1000#, cannot pump in. Dril cmt retainers, chase retainer to 3500'. Test csq 500#, ok. GIH up thg + rods. Complete after repairing csq leak. Well TA 8-9-83

18. I hereby certify that the foregoing is true and correct

SIGNED

RR Pite

TITLE

Area Engineer

DATE

8-12-83

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

ACCEPTED FOR RECORD

RR

DATE

AUG 31 1983