

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Co
P. 1980
Hobbs, NM 88241

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

PLAINS PETROLEUM OPERATING COMPANY

3. Address and Telephone No.

415 W. WALL, SUITE 1000 MIDLAND, TX 79701 915/683-4434

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FSL & 1995' FEL, Sec. 34 (O), T23S, R37E

5. Lease Designation and Serial No.
NM LC064118

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Eva E. Blinbry #2

9. API Well No.

30-025-10937

10. Field and Pool, or Exploratory Area

Langlie Mattix 7 Rvrs Queen GB

11. County or Parish, State

LEA, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other reactive as POW status
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Regarding Incident of Non-Compliance AJM-063-97


10-3-97 Unhang well, unseat pump, POOH w/rods & pump. ND WH, POOH w/tbg, replace bad jt tbg, hydrotest tbg to 5000 psi, ok.

10-4-97 PU new pump, WIH w/ pump (20-150-RHBC) & 3/4 rods, replacing 75 rod boxes. Hang on, space out.

10-11-97 Pump plunger failed on pump run 10-4-97. PU new pump, RIH w/20-150-RHBC-16-4 pump & 1-2' 3/4" pony rod, 137 (3425') 3/4" sucker rods & 1-4' 3/4" pony rod, 1-16' 1-1/4" polish rod w/8" liner, hang on, space out, leave unit pumping to battery.

Well placed back on production @ 10 BOPD, 329 BWPD & 2 MCFGPD in 24 hs.

Remove from SI/TA status.

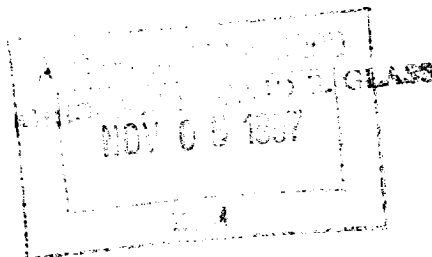

RECEIVED
1997 OCT 28 P 1:50
BUREAU OF LAND MGMT.
HOBBS, NEW MEXICO

14. I hereby certify that the foregoing is true and correct

Signed Bonnie Husband Title Admin. Assist. Date 10/23/97

(This space for Federal or State office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any: