

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 18644

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Wilson 17 Federal

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT
Siquis Tapsul Yates
Seven Rivers

11. SEC., T., E., M., OR BLE. AND
SURVEY OR AREA

Sec. 17, T26S, R36E

12. COUNTY OR PARISH 13. STATE

Lea

NM

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

HNG OIL COMPANY

3. ADDRESS OF OPERATOR

P. O. Box 2267, Midland, Texas 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1980' FNL & 660' FEL, Section 17

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

2953' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF: 12/30/81

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2/1/82 - TOH W/ 108 jts 2-3/8"

Cement retainer at 3203' - sq. perfs 3260' - 3248'w/75 sx.


C1 H Cement + 24 sx Cement on top.

Spot 25 sx C1H from 1492' - 1292'

Spot 25 sx C1H from 90' to surface.

2/2/82 - Bull head 45 sx C1H into Casing & spot 15 sx C1H 90' to surface.

2/3/82 - Surf. plug OK. - Cut off head, Weldon Dry hole marker, Cut off anchors.

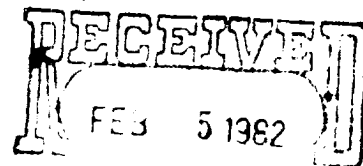

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

No Casing recovered.

18. I hereby certify that the foregoing is true and correct

SIGNED

Betty Gildon

Betty Gildon

TITLE

Regulatory Analyst

DATE

2/4/82

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

NOV 3 1982

FOR

JAMES A. GILHAM *See Instructions on Reverse Side

DISTRICT SUPERVISOR