


UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

N. M. OIL CONS. COMMISSION

BOX 1983

HOHES, NEW MEXICO 882

Form Approved.
Budget Bureau No. 42-R1424

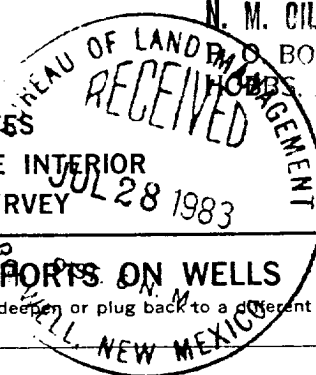

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☒ gas well ☐ other ☐

2. NAME OF OPERATOR
Jubilee Energy Corporation

3. ADDRESS OF OPERATOR 79705
3100 N. "A", Bldg. E, #103, Midland, TX

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980' FSL & FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐

SUBSEQUENT REPORT OF:

☒
☐
☐
☐
☐
☐
☐
☐

5. LEASE

NM-16353

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Exxon "A" Federal

9. WELL NO.

2

10. FIELD OR WILDCAT NAME

Double "X" Delaware

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 27, T-24-S, R-32-E

12. COUNTY OR PARISH

Lea

13. STATE

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

3542 GL

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6-02-83 Perforated 5½" casing from 4854' to 4858' and 4864' to 4872' with 1 shot/foot.

6-07-83 Acidized w/1500 gallons 7½% Hcl. Pumped 3-5 bbls/min. @ 1000#. Swabbed and flowed back load.

6-08-83 Fractured perforations w/9000 gallons 2% Kcl + 3000 gallons Methonal 75 Quality foam + 27,000# 20/40 sand and 24,000# 10/20 sand. Pumped 15 bbls/min. @ 3100#. Formation broke @ 3700#. 15" SIP - 1860#.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE President DATE 7-25-83

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____

DATE

ACCEPTED FOR RECORD

AUG 19 1983

*See Instructions on Reverse Side

ROS WELL, NEW MEXICO