


THIS WELL IS IN THE COTTON DRAW UNIT

Budget Bureau No. 42-R358.4.  
Approval expires 12-31-60.

Form 9-381a  
(Feb. 1961)

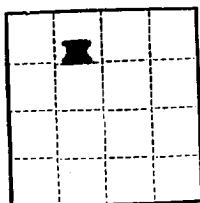

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office **Las Cruces**  
Lease No. **LC-062300**  
Unit \_\_\_\_\_

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Lease No. **186466**  
Cotton Draw Unit

**TEXACO Inc., P.O. Box 352**  
**Midland, Texas** **March 6**, 19**61**

Well No. **16** is located **510** ft. from **N** line and **1830** ft. from **W** line of sec. **22**

**NE 1/4, Section 22** **T-25-S** **R-32-E** **100M**  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

**Undesignated Delaware Sand** **Lee** **New Mexico**  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **3421** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

**TD - 4762'**  
**7-5/8" O.D. casing set at 330'**

Ran **4732'** of **2-7/8" O.D. tubing (casing)**, **6.40 lb.**, **J-55**, **8-R**, and cemented at **4762'** with **200 sq Incon 4 1/2 Gal. Plug** at **4751'**. Job complete **1:30 P.M. February 24, 1961**.

Tested **2-7/8" O.D. tubing (casing)** for 30 minutes with **1500 PSI** from **7:30 to 8:00 A.M. February 27, 1961**. Tested **O.K.** Drilled cement plug and re-tested for 30 minutes with **1500 PSI** from **10:12 to 10:42 A.M. February 27, 1961**. Tested **O.K.** Job complete **10:42 A.M. February 27, 1961**.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **TEXACO Inc.**  
Address **P.O. Box 352**  
**Midland, Texas**  
**W. B. Hubbard**

By *W. B. Hubbard*  
Title **Assistant District Superintendent**