

(SUBMIT IN TRIPLICATE)

 UNITED STATES
 DEPARTMENT OF THE INTERIOR
 GEOLOGICAL SURVEY

 Land Office Las Cruces
 Lease No. 03279(e)
 Unit Lease

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Carlson 8 25
 Well No. 5 is located 220 ft. from N line and 1780 ft. from E line of sec. 25
SW 1/4 Sec. 25 (1/4 Sec. and Sec. No.) 25 (Twp.) 37 (Range) N. M. P. M. (Meridian)
Justis (Field) Lea (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 3014 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Present conditions: squeeze job done and reported 11-9-60 did not hold up. Blinebry & Tubb zones are communicating.
 we propose to squeeze off all perforations (Blinebry 5416-30, 5554-98, 5568-70, 5575-80, 5583-87, Tubb 5796-5710, 5722-30, 5754-76, 5792-98, 5802-06, 5812-16, 5824-28; 5837-41.) and squeeze perfs. at 5635'. with 150 ex. and drill out all cement and packers in hole. Recomplete in Tubb 5754-76, 5792-98, 5802-06, 5812-16, 5824-28, 5837-41 and Blinebry 5416-30. Both Tubb & Blinebry to be acidized with 900 gal. mud acid and sand fraced with 10,000 gal. 1 lb. sand per gal. Install necessary dual equipment. For well completion.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Westates Petroleum Co.


Address P.O. Box 1301

Jal, New Mexico

Phone 397-2600

By [Signature]

Title Division Engineer

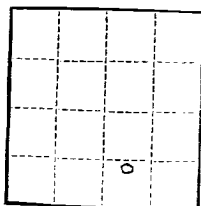

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Las Cruces
Lease No. 032379(a)
Unit Lease

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Carlson 7 25 November 9, 1960
Well No. 5 is located 120 ft. from N line and 120 ft. from E line of sec. 25
S4, 11E, Sec. 25 25 11E T. 11N. R. 1E.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Justis Lea New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3054 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Perforate 8 holes at 263' between Blinney perforations and Turbs perforations. Run 4 in. cement with welen squeeze bailer. W.O.C. for 45 hr. Drilled out and check perforations with 1000# for 30 min. Checked to see if seal communication between zones and had none. Ran tubing and put back on production.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Estates Oil and Gas Company

Address Box 1201

Jal, New Mexico

Phone 392-4000

By Elmer S. Lipp
Title Production Superintendent