

Step Rate Injection Test Report


for

Texaco E & P Inc.

30-025-12315

WDDU #68 ~ m. 32.245.38e
660/S & 660/W

8/14/01

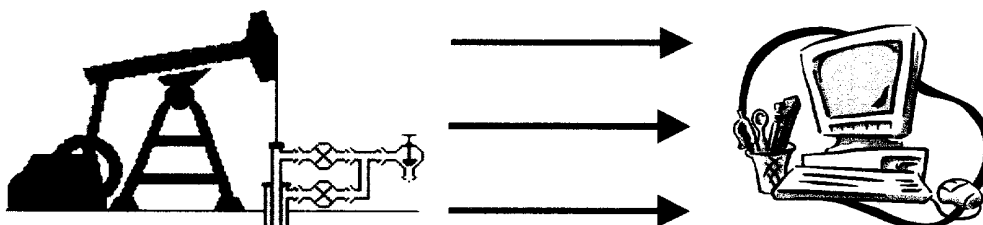

Increase
POST SUBSEQUENT ~~P&A~~ TO RBDMS
COMPLIANCE SCREEN

TABLE OF CONTENTS

SECTION I	CONTENTS
------------------	-----------------

SECTION II	SEQUENCE OF EVENTS
-------------------	---------------------------

SECTION III	DATA REPORT
--------------------	--------------------

SECTION IV	CHART
-------------------	--------------



COMPANY : Texaco E & P Inc.
WELL: WDDU #68
COMPANY REP: Tim Nein
PERFORATIONS: 6284' - 6396'

SERVICE DATES : 8/14/01
TEST TYPE : Step Rate Injection
PPS TECHNICIANS : D. Ginanni
BHP GAUGE DEPTH: N/A
6244' - 6245'

08/14/01	10:35	Start Pumping @ 500 BPD
08/14/01	11:05	Increase to 800 BPD
08/14/01	11:35	Increase to 1100 BPD
08/14/01	12:05	Increase to 1400 BPD
08/14/01	12:35	Increase to 1700 BPD
08/14/01	13:05	Increase to 2000 BPD
08/14/01	13:35	Increase to 2400 BPD
08/14/01	14:05	Cease pumping



COMPANY : Texaco E & P Inc.
WELL: WDDU #68
COMPANY REP: Tim Nein
PERFORATIONS: 6284' - 6396'

SERVICE DATES : 8/14/01
TEST TYPE : Step Rate
PPS TECHNICIANS : D. Ginanni
BHP GAUGE DEPTH: N/A

	10:35	794.2				
	10:40	794.6	1.9	554.8	16.18	
	10:45	757.3	3.9	555.4	16.20	
	10:50	739.2	5.8	560.8	16.36	
	10:55	752.8	7.8	564.8	16.47	
	11:00	800.5	9.7	561.9	16.39	
1	11:05	808.7	12.4	780.4	22.76	
	11:10	855.4	15.2	786.3	22.93	
	11:15	859.5	17.9	787.5	22.97	
	11:20	882.1	20.6	790.3	23.05	
	11:25	891.1	23.3	780.4	22.76	
	11:30	908.7	26.1	788.8	23.01	
2	11:35	1021.5	29.5	974.1	28.41	
	11:40	1025.1	33.0	1008.3	29.41	
	11:45	1039.9	36.4	999.2	29.14	
	11:50	1049.3	39.9	1011.4	29.50	
	11:55	1058.9	43.4	1005.8	29.34	
	12:00	1049.6	46.9	1004.4	29.30	
3	12:05	1178.2	51.7	1364.3	39.79	
	12:10	1215.1	56.3	1347.3	39.30	
	12:15	1257.6	61.1	1356.7	39.57	
	12:20	1283.8	65.8	1358.5	39.62	
	12:26	1295.6	70.5	1358.8	39.63	
	12:30	1245.1	75.2	1363.0	39.75	
4	12:35	1400.4	81.3	1740.7	50.77	
	12:40	1621.0	87.2	1722.4	50.24	
	12:45	1563.0	93.6	1828.1	53.32	
	12:50	1587.0	99.8	1778.7	51.88	
	12:55	1545.6	106.0	1781.9	51.97	
	13:00	1583.6	112.1	1780.0	51.92	
5	13:05	1781.1	119.2	2043.1	59.59	
	13:10	1792.6	126.7	2142.0	62.48	
	13:15	1892.1	134.1	2129.0	62.09	




COMPANY : **Texaco E & P Inc.**
 WELL: **WDDU #68**
 COMPANY REP: **Tim Nein**
 PERFORATIONS: **6284' - 6396'**

SERVICE DATES : **8/14/01**
 TEST TYPE : **Step Rate**
 PPS TECHNICIANS : **D. Ginanni**
 BHP GAUGE DEPTH: **N/A**

	13:20	1898.8	141.4	2127.4	62.05	
	13:25	1892.5	148.8	2126.7	62.03	
	13:30	1777.4	156.2	2124.8	61.97	
6	13:35	2024.7	165.2	2601.3	75.87	
	13:40	2036.8	174.2	2573.2	75.05	
	13:45	2035.3	183.1	2564.7	74.80	
	13:50	2009.1	192.0	2571.1	74.99	
	13:55	2105.0	200.9	2563.7	74.78	
	14:00	2133.6	209.9	2576.2	75.14	
7	14:05	2395.6	220.3	2993.8	87.32	

Pacific PROCESS SYSTEMS, INC.

Step Rate Injection Test

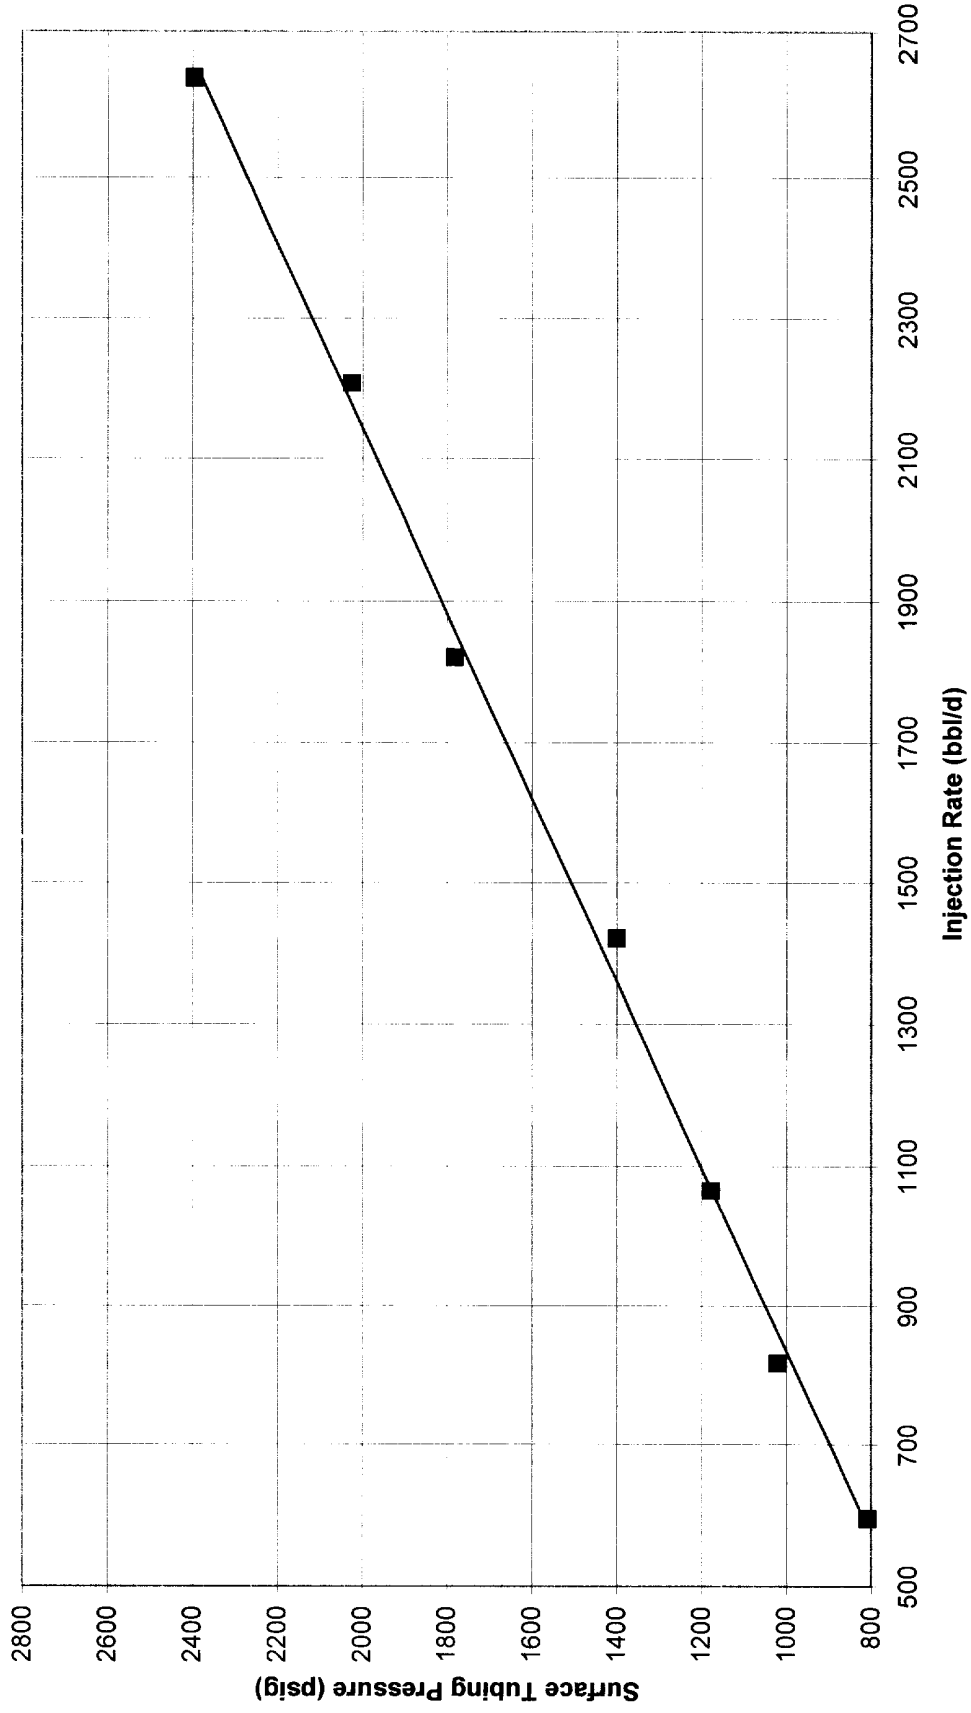

Phone: (505) 392-8813
Fax: (505) 392-6612

3406 Lovington Hwy.
Hobbs, NM 88240