

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office or Commission Office on Rule 1106)

Operator's Company Seco Production Company		616 Vaughn Bldg., Midland, Texas	
County Crawford State	Section (Township) 2 L	Range 4	Range 24 South 38 East
Date Work Performed 9-29-65	Well Name Stateline Ellenburger	County Lea	

THIS IS A REPORT OF WORK DONE ON A WELL.

XXX

Plugging

Detailed account of work done, including quantity of materials used, etc.

(Note: This zone abandoned as unproductive. Completion attempt in Ellenburger section will follow.)

Perforated with 3/8" jet shots the following intervals:

9326 9335 9335 9345 9349

Treated these perforations with 500 gallons mud acid and swabbed dry.

Retreated with 5000 gallons 15% acid and swabbed dry.

Retreated with 10,000 gallons 15% acid and swabbed dry.

Cemented with 100 sacks Incor Neat, squeezing 90 sacks into formation at 4300 psi and leaving 10 sacks in casing. Drilled out good cement 9250' - 9400'. Tested casing string with 3000 psi, no pressure loss at end of 1 hour.

Witnessed by G. E. Oliver	Position Production Supt.	Company Seco Production Company
-------------------------------------	-------------------------------------	---

FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

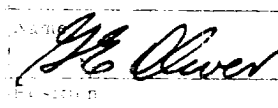
D F Elev.	T D	P S D	Producing Interval	Completion Date
Tubing Diameter	Tubing Depth	Oil String Diameter	Oil String Depth	
Perforated interval(s)				
Open Hole Interval				

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	COR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover						
After Workover						

OIL CONSERVATION COMMISSION

I hereby certify that the information given above is true and complete to the best of my knowledge.

Approved by 	Date 	(G. E. Oliver)
Title	Position	Company
	Production Superintendent	Seco Production Company

