

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other ☐
2. NAME OF OPERATOR  
*Continental Oil Company*
3. ADDRESS OF OPERATOR  
*Box 460, Hobbs, N.M. 88240*
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: *330' FNL + 1725' FEL*  
AT TOP PROD. INTERVAL: *5' mp*  
AT TOTAL DEPTH: *5' mp*
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) *Set 5 1/2' Prod. CSG* ☒

SUBSEQUENT REPORT OF:

- ☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐

5. LEASE

*LC-032326 b*

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

*NMFU*

8. FARM OR LEASE NAME

*Jack B 30*

9. WELL NO.

*2*

10. FIELD OR WILDCAT NAME

*Jalmat Longhorn Matfix*

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

*Sec. 30, T. 24S, R. 37E*

12. COUNTY OR PARISH

*Lea*

13. STATE

*N.M.*

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

*3268.2 GR*

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

U. S. GEOLOGICAL SURVEY  
HOBBS, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

*Drilled 7 7/8" hole from 1142' to 3650' T.D. Ran 5 1/2" N+ K-55 CSG set at 3650'. Set DV Tool at 2251' cmt'd 1st stage w/206 SX of class 'C' cmt with additives. Plug down at 7:15 P.M. 3.20.78. opened the DV Tool and circ. for 6 Hrs. cmt'd 2nd stage w/405 SX of class 'C' cmt with additives. Plug down at 2:05 A.M. 3.21.78. Did not circ. cmt. Ran Temp. Survey, top of cmt at 1200'. Rel Rig at 6:00 A.M. 3.21.78. Shut-in waiting on Compl. Rig.*

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_

Set @ \_\_\_\_\_ Ft.


18. I hereby certify that the foregoing is true and correct

SIGNED *Wm. A. Butterfield* TITLE *ADMIN. SURV.* DATE *3-22-78*

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_

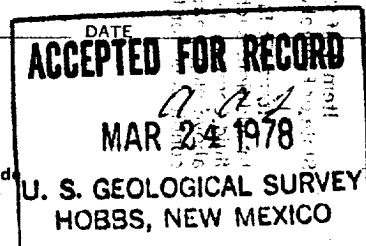

*USGS(5), NMFU(4), File*

\*See Instructions on Reverse Side

RECEIVED

MAR 28 1978  
OIL CONSERVATION COMM.  
HOBBS, N. M.