

Step Rate Injection Test Report

for

30-025-31487

Texaco E & P Inc.

WDDU #120 - F-32-24s-38e

8/15/01

2190/N 9 2224/W

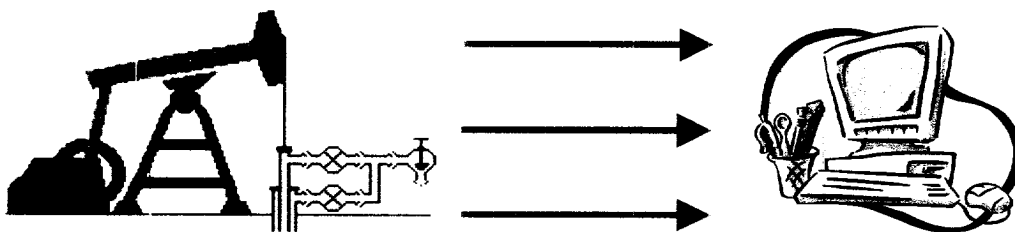


TABLE OF CONTENTS

SECTION I	CONTENTS
SECTION II	SEQUENCE OF EVENTS
SECTION III	DATA REPORT
SECTION IV	CHART



COMPANY : Texaco E & P Inc.
WELL: WDDU #120
COMPANY REP: Tim Nein
PERFORATIONS: 6467' - 6493'

6396

SERVICE DATES : 8/15/01
TEST TYPE : Step Rate
PPS TECHNICIANS : D. Ginanni
BHP GAUGE DEPTH: N/A

08/15/01	13:16	Open well, start pumping @ 500 BPD
08/15/01	13:46	Increase to 1000 BPD
08/15/01	14:16	Increase to 1500 BPD
08/15/01	14:46	Increase to 2000 BPD
08/15/01	15:16	Increase to 2500 BPD
08/15/01	15:51	Cease pumping



COMPANY : Texaco E & P Inc.
 WELL: WDDU #120
 COMPANY REP: Tim Nein
 PERFORATIONS: 6467' - 6493'

SERVICE DATES : 8/15/01
 TEST TYPE : Step Rate
 PPS TECHNICIANS : D. Ginanni
 BHP GAUGE DEPTH: N/A

	13:16	1473.5				
	13:21	1461.4	1.6	473.4	13.81	
	13:26	1435.8	3.4	504.5	14.71	
	13:31	1442.3	5.1	500.6	14.60	
	13:36	1510.9	6.9	502.8	14.66	
	13:41	1594.6	8.7	531.4	15.50	
1	13:46	1632.3	10.5	521.0	15.20	
	13:51	1638.6	13.8	946.3	27.60	
	13:56	1627.3	17.0	918.9	26.80	
	14:01	1636.9	20.3	959.7	27.99	
	14:06	1628.8	23.7	964.4	28.13	
	14:11	1665.2	27.1	970.6	28.31	
2	14:16	1710.7	32.2	1483.9	43.28	
	14:21	1725.1	37.4	1485.1	43.32	
	14:26	1737.0	42.5	1477.7	43.10	
	14:31	1805.5	47.6	1477.8	43.10	
	14:36	1798.3	52.8	1476.9	43.08	
	14:41	1969.2	58.0	1513.4	44.14	
3	14:46	1986.2	64.8	1967.6	57.39	
	14:51	2014.3	71.6	1959.0	57.14	
	14:56	2014.6	78.5	1967.0	57.37	
	15:01	2018.8	85.3	1953.7	56.98	
	15:06	2014.7	92.1	1962.4	57.24	
	15:11	2361.7	99.1	2019.7	58.91	
4	15:16	2324.5	107.9	2542.8	74.17	
	15:21	2256.1	116.9	2579.0	75.22	
	15:26	2264.8	125.8	2580.1	75.25	
	15:31	2265.0	134.8	2571.8	75.01	
	15:36	2264.9	143.7	2574.3	75.08	
	15:46	2310.7	152.7	2590.1	75.54	
5	15:51	2589.5	161.7	2580.8	75.27	

Pacific *PROCESS SYSTEMS, INC.*

Step Rate Injection Test

